

4700 Northwest Parkway Suite 230
Hilliard, Ohio 43026
Tel: 614.430.0813

Fire Origin & Cause Report

EFI Global File No.: 019.02004
October 11, 2021

Residential Structure Fire

Ottercreek Group LLC
5281 Locust Hill Lane
Dublin, Ohio 43017

Date of Loss: February 10, 2021
Claim No. NONE

Prepared For:

Ottercreek Group LLC

Attn: Scott Hamilton
21865 Shirk Rd.
Marysville, Ohio 43040

ASSIGNMENT

EFI Global Inc. (EFI) received this assignment on September 22, 2021 from Scott Hamilton with Ottercreek Group LLC, to investigate a residential structure fire at 5281 Locust Hill Lane, Dublin, Ohio 43017.

The scope of this assignment and subsequent instructions were to:

- Determine the origin and cause of the fire.
- Prepare a report of the investigation.

SUMMARY OF CONCLUSIONS

- An unknown person(s) unlawfully entered the unoccupied structure through a window in the great room located centrally on the south (rear) side of the structure.
- The fire originated near the south wall of the great room.
- The fire was caused by an unknown person(s) dispersing an ignitable liquid that had been dispersed across the great room and down a hallway on the west side of the structure.

BACKGROUND

The subject property had been undergoing a remodeling project that commenced in March of 2020. The structure was being converted from a single-family dwelling to a residential assisted care home for seniors. **Figure 1** depicts a 2017 photograph of the general exterior of the property pre-fire.



Figure 1: 2017 Photo from Franklin County Records.

The day prior to the fire staining was taking place in the indoor pool room at the east end of the structure. Staining rags were laid out around the perimeter of the pool. Additional staining was taking place on the second floor near the front of the structure, those rags were laid out on sawhorses.

The Washington Township Fire Department arrived on scene at 12:22 a.m. to find heavy smoke and fire. Suppression was completed defensively using three aerial devices along with ground level master stream devices.

PROCEDURES

The assignment was conducted utilizing a systematic approach identified as the scientific method. The scientific method is a principle of inquiry that forms a basis for legitimate scientific and engineering processes. The scientific method is the recommended methodology provided by the National Fire Protection Association 921, Guide for Fire and Explosion Investigations, 2021 Edition.

1. A fire scene examination was conducted on September 23, 2021. Present during this examination was Mathew Decker of EFI Global. Scott and Keith Hamilton were present for portions of the examination.
2. The following individuals were interviewed:
 - Scott Hamilton (owner)
 - Colton Hamilton (son)
 - Keith Hamilton (brother)
 - Investigator Chad Hamilton (no relation) -Washington Township Fire Department
3. Washington Township Fire report was obtained and reviewed.
4. Dublin Police reports were obtained and reviewed.
5. Fire Debris samples were collected and sent for analysis.
6. Fire Department photos and Ring Doorbell videos were obtained from the Washington Township Fire Department and reviewed.
7. A written report was completed at the request of Scott Hamilton.

DATA COLLECTION

Site Examination Observations

The structure was a two story residential assisted care home for seniors. The structure was situated in an upscale neighborhood on a Cul-de-sac. The front of the structure was referenced to face north. The exterior walls were wood framed and finished on the outside with wood siding. The roof was covered with asphalt shingles.

The front (north) side of the structure had severe fire damage to the second story in the center of the structure. The roof had been consumed along with most of the west wall of the second story. The second story windows had been broken out, charring to the upper portion of the window frames and surrounding wood siding established the fire had ventilated out of the second-floor front facing windows. The upper portion of the single-story west

end roof had been consumed nearly its entire length. The first-floor entrance door and windows from the center to the west end had been boarded over with plywood. Windows on the single-story section at the east end were found to be intact.

The single-story east end displayed no fire damage. The west end of the second story in the center of the structure had smoke staining and mass loss visible to the soffit.

The west end, south side single story section displayed no fire damage windows and doors were intact and functional. The two-story addition near the center of the structure on the south side had charring and melted soffit on its west side. The second-floor windows were broken out and the first-floor windows were boarded over on the south side. From the west side, the first-floor wall of the addition was covered with OSB, the second-floor wall was mostly consumed and or collapsed and the roof had been consumed.

Immediately to the west of the addition was a debris pile that consisted of metal scaffolding and burned wooden structural components. A portion of the south side of the great room subfloor was visible in front of a temporary wall that had been constructed diagonally across the south end of the room. A portion of an irregular shaped fire pattern was visible in the south west corner. Broken glass was found in this area that was found to be clean on both sides. A sample of the glass was collected as evidence. The original two-story section was consumed in a radial pattern that decreased in intensity from the south wall toward the front of the structure.

The west end of the center structure had a partially boarded window with charring and mass loss of the wall near the peak.

The single-story section at the west end had its door and windows boarded over and the roof was consumed from the second story section to approximately three feet from the west end of the structure.

The rear yard had a tree line that on its east and south sides completely blocked the view of Dublin Road behind the property.

Electrical service entered the structure via underground service lateral on the south side (rear) near the west end. The electrical load centers were positioned in the basement, first floor foyer, and pool area, with main breakers at the rear service entrance. One breaker was found in the "tripped" position the other was found in the "OFF" position. Natural gas service entered the structure on the north side of the structure.

The interior examination began at the rear door entering into the pool room at the east end of the structure. Mr. Hamilton provided access through the locked battery-operated combination handle. The lock operated properly and automatically locked. There was no evidence of forced entry or damage to the door. The pool room had minor smoke damage throughout and soot depositing above the door located in the north west corner of the room. A furnace and pool heater were in a room on the north side of the pool, no fire damage was noted to the room or its components.

Smoke alarms were not identified within the structure. The alarm system for the structure was not yet completed. The fire suppression system was installed with the final inspection was scheduled for the morning of the fire and was not active at the time of the fire.

The room to the north of the pool room contained a saw, planer and building materials. It had moderate smoke damage and minor melting of plastic materials along the west side, the ceiling on the west half of the room had

been pulled down. The room across the hall to the north contained a worktable with paper plans on it. The room had moderate smoke damage at its upper level.

In the hallway to the west of these room was the upper edge of a fire pattern that extended from mid-wall in a downward fashion toward an additional room to the south and the foyer. The fire pattern had charred paint on its outer edges in the hallway that transitioned to calcified drywall near the foyer.

The room south of the foyer and east of the great room had severe soot deposits and drywall calcification that increased in intensity toward the great room to the west. At the south wall of the room was a doorway that led to the two-story addition. The two-story addition consisted of an elevator and two living units each containing a bedroom and bathroom. The bathrooms were under construction and did not have fixtures yet. Doors to the rooms had minor charring at their tops and soot deposits on the walls, all of which increased in intensity toward the east and the great room.

The foyer had an open stairway and cathedral ceiling that had severe fire damage from top to bottom. Charring was visible on both the top and bottom of the open stairway. The charring and drywall calcification increased in intensity toward the south which was the entrance to the great room in the center of the south side of the structure. The roof above the foyer had been consumed.

To the west of the foyer was the kitchen, which had moderate soot deposits throughout specifically at the upper level, and blistering paint toward the south east closet to the great room. The ceiling had been pulled down. Some appliances were in the room but had not yet been installed, and there were no cabinets or plumbing fixtures.

A small room along the west wall of the kitchen contained two electrical distribution panels, the covers for both were found on the floor. Wiring within both panels was intact with color showing on the insulation. Both panels had several open circuits available, and all circuit breakers were found in the "tripped" position. The ceiling above the panels was fire damaged, and it was noticed that the roof above this area had been consumed. Insulation on the branch circuits in the ceiling had been consumed. There was no evidence of electrical activity or a fault found.

The great room displayed the most severe fire damage. It was evident that previous debris removal had been conducted within the room. A temporary wall had been installed diagonally across the room at the south end. The roof above and several ceiling joists had been totally consumed. The remaining ceiling joists were heavily charred with the most severe charring and consumption of the second floor that extended partially over the room and located near the center. Remaining drywall had a heavy soot deposition and calcification. The plywood subfloor was extremely bowed upward and fully loose in several locations.

An irregular fire pattern extended from the southwest portion, then turned in both the east and west directions towards the interior entrances. A hole approximately four feet in diameter was found burned through the subfloor near the northwest end. Several holes were noted in the most charred areas of the floor. Several wall studs had been exposed; some were charred on the outer edges only and others were undamaged.

An electrical receptacle outlet box could be seen along the east wall. The wiring appeared to be folded into the box as if the receptacle had not yet been installed, this was visualized from across the room. An existing receptacle was noted on the west wall above a hole burned through the floor. The receptacle had surface thermal damage and was found to be along the outer edge of a "V" fire pattern extending up the wall.

A hallway extended to the west from the great room that led to the basement stairway, a south exterior door, and three additional living units. The roof above the hallway had been mostly consumed and debris still covered the floor. Charring to molding and small fire patterns were visible on the walls at the floor level approximately halfway down the hall.

Debris removal was completed, and an irregular fire pattern was found on the floor that was an extension of the same pattern found in the great room. The remaining rooms had moderate soot deposition and a consumed roof; all damage decreased in intensity away from the great room area. The hole to the south leading to a rear exterior door was also covered in debris and the exterior door was found on the floor. Upon examination of the door and door frame both exhibited evidence of forced entry around the locking mechanism.

The basement was examined and found to have minor to moderate smoke damage throughout. Evidence of standing water was noted on the floor and walls. Fire damage was noted to the ceiling area directly under the great room consisting of a hole burned through the ceiling/floor and partially consumed and heavily charred joist. Several areas had been shored up with 2" x 4" s. Fire debris within the room was concentrated under the hole that had burned through the great room floor. No evidence of a fire originated in the basement was found.

The examination of the remaining portions of the second floor was limited due to structural instability. Fire patterns found on the second floor increased in intensity from the area above the great room.

Examination transitioned back to the great room area. Due to the floor conditions and structural instability the great room was only accessed by areas close to the entrances. Three fire debris samples were collected from the great room areas that could be accessed. Two additional fire debris samples were collected from the floor of the west hallway.

Evidence

The below evidence has been placed in an EFI Global evidence storage facility and will be maintained under the custody and control of EFI Global until written authorization to dispose of the evidence is received.

Item Number	Description
1	Floor fire debris East Great room near fireplace
2	Floor fire debris West Great room entrance
3	Floor fire debris West Great room wall near stairs
4	Floor fire debris East end hallway
5	Floor fire debris West end hallway
6	Glass removed from south side of Great Room

Fire Debris Analysis Results

Items #1-5 were forwarded to the EFI Global chemical laboratory on September 23, 2021 for analysis for the presence of ignitable liquids. On September 28, 2021, a laboratory report was received stating debris samples 1-5 tested negative for the presence of ignitable liquids. Negative samples do not preclude the possibility that an ignitable liquid was utilized and subsequently consumed by the fire. A copy of the laboratory results is provided as **Attachment 3**.

Weather Information

Weather data on the date of the fire was obtained from www.wunderground.com. Temperatures at the time of the fire were 16 degrees Fahrenheit. Mostly cloudy skies, no precipitation, and a 6-mph north wind. A copy of the weather report is provided as **Attachment 6**.

Interviews

Scott Hamilton – Property Owner

At the time of the fire, remodeling activities were on going throughout the structure. There were no known issues with the structure. The sprinkler system was inactive, and they were awaiting the final inspection the week of the fire. There were no floor coverings installed at the time of the fire and electrical work was on-going. Activities the day prior to the fire included painting of walls and staining of wood trim being completed by his son Colton and his brother Keith. Doors were also being hung by a subcontractor. Mr. Hamilton stated that they did not have a gas can or gas operated equipment on the property. The only flammable liquids would be stain, and possibly brush cleaning solvents. He is a non-smoker.

The fire department used a chain saw to open the front door and told him they were able to push the rear pool room door open. Mr. Hamilton confirmed the battery-operated electronic locking handle was the same that was present at the time of the fire.

Mr. Hamilton explained the following issue he was having with several neighbors concerning the property's use. In February 2018, Priscila, and Scott Hamilton, reached out to the City of Dublin Planning Division, to confirm whether zoning code would allow for converting a single-family house for use as a residential assisted care home for seniors in the Dublin community. Through March and April 2018, they were able to confirm with the City of Dublin Planning Division and the City of Dublin's legal counsel that this was a permitted use under zoning provisions defined as a community residence, allowing for up to 12 residents with disabilities.

On April 26, 2018 the Hamiltons viewed the property at 5281 Locust Hill Lane and entered into a contract to purchase the home on May 2, 2018. At this point they were advised by the City of Dublin Planning Division to file for a Certificate of Zoning Plan Approval; on May 3, 2018 they submitted a Zoning Compliance Request Form to the City of Dublin. On May 8, 2018 the Hamiltons received a letter confirming they were in compliance with the zoning code to convert the home for five or more unrelated individuals with disabilities with a maximum of twelve residents.

The Hamiltons closed on the home on July 18, 2018. The Hamiltons contracted with an architect on September 15, 2018 and submitted architectural drawings and a building permit application to the City of Dublin on December 4, 2018. The plans were revised based on feedback from the City of Dublin, and they received phased approval of the revised plans on June 7, 2019 followed by full approval from the City with full building permit issued on December 2, 2019. The Hamiltons closed on a construction loan on February 14, 2020. Additional changes were made, and a full building permit issued on November 4, 2020.

In August 2020, the Hamiltons learned that their neighbors objected to their plans and were contacted by Attorney Michael Close (former mayor and Council member) inviting them to share their project plans with the neighbors, which they did on August 31, 2020. Then on Friday, October 2, 2020 a Motion for Temporary Restraining Order (TRO) was filed by some neighbors to "stop construction, construction activity or approval of permits at 5281 Locust Hill Lane to preserve the residential nature of the neighborhood."

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

On October 13, 2020, the Hamilton's legal counsel filed a motion to vacate the TRO which was granted on October 21, 2020. This TRO work stoppage from October 6 through October 21, 2020 ultimately delayed construction on the property. Included in the October 2, 2020 motion for TRO, was a motion for Preliminary and Permanent Injunction to stop construction. On October 28, 2020 a full hearing was held, and the motion ultimately denied by the court on May 4, 2021.

On December 7, 2020, during the Citizen Comment period of the Dublin City Council meeting, Locust Hill Lane resident David Tiefenthaler made a statement on behalf of all neighbors, followed by a statement by their Attorney Michael Close including misinformation and disparaging remarks, objecting to the Hamilton's project, and arguing that it violated the deed restrictions.

Based on the comments made by the Council during the meeting, as well as potentially three Executive Session Council meetings on December 12, 2020, January 19, 2021, and February 8, 2021, regarding "Conference with an attorney for the public body concerning disputes involving the public body that are the subject of pending or imminent court action," the Hamilton's believe that some or all of the Council were actively seeking strategies to stop the project from moving forward and were communicating/coordinating with Michael Close to prevent the plans from being completed.

On February 25, 2021, one of the neighbors, David Haid, called Scott's brother Keith, who he had known previously through work, and told Keith that the neighbors wanted to buy the property from the Hamilton's. David Haid placed a second call to Keith on March 12, 2021 as a follow up to his prior call.

Keith Hamilton (Scott Hamilton's brother)

The day before the fire Keith Hamilton worked at the property until 3:00p.m. He had spent most of the day staining wood trim on the second floor towards the front. When finished his staining rags were laid out over sawhorses. He is a non-smoker.

Keith Hamilton stated at the time of the fire the great room contained some scaffolding, a door roller, and some buckets of drywall mud. He believed the receptacles were installed but was sure nothing would have been plugged into them.

Keith Hamilton added the neighbors had created several issues and he had been approached on two occasions by David Haid to inquire with his brother to sell the property to the neighbors. The neighbors would often drive by taking pictures.

Keith Hamilton believed the neighbor across the street at 5300 was a snowbird and was in Florida at the time of the fire. Keith Hamilton stated they did not have a gas can or gas operated equipment at the property.

Colton Hamilton (Scott Hamilton's son)

614.804.0683

Colton Hamilton was working at the house the day before the fire and left at 3:30p.m. The contractor hanging interior doors, Tom McMillen, was still there when he left. That day he had painted primer on some of the walls and was staining wood trim in the pool room. When finished he laid his staining rags out around the pool. He is a non-smoker.

Colton Hamilton believed the neighbor across the street at 5300 was a snowbird and was in Florida at the time of the fire. Colton Hamilton stated they did not have a gas can or gas operated equipment at the property.

Fire Official's Report and Interviews

The Washington Township Fire Department received the call at 12:17 a.m. on February 10, 2021 and arrived on scene at 12:22 a.m. to find heavy smoke and fire showing from the second floor. Fire suppression was completed by defensive operations utilizing three aerial devices along with ground operated master stream devices. A copy of the Washington Township Fire Department report is provided as **Attachment 4**.

Investigator Chad Hamilton Washington Township Fire Department

614.652.3933

chamilton@wtwp.com

Investigator Chad Hamilton was interviewed by Matthew Decker and Kevin Sanders of EFI. Investigator Hamilton stated that it was a pretty political neighborhood, and the neighbors did not seem to like the idea of the proposed building use. Many complaints had been filed with the township from the neighbors. He believed there was also pending litigation between the neighbors and property owner. There had been a break-in back in December and some tools were missing. The owners provided pre-fire photos to the fire department.

The fire department interviewed all contractors which were there day prior to the fire. The property contained a nonactive fire suppression system which had only had the hydro test done, the valves were turned off at the hotbox, and the alarms were not monitored yet. The city of Columbus was scheduled to inspect and perform the backflow test.

The fire was found going through the roof just after midnight. The first arriving officer Lt. Erickson of Ladder 95 in a statement said upon arrival, fire was exiting all windows and openings on the second floor. Forced entry was made through the front door under the canopy. The rear door to the pool area was found not to be able to be secured as there was no strike plate on the frame. However, the door was closed at the time of the fire.

Investigator Hamilton stated the owner had told him construction was 80% complete, however it only appeared to be approximately 60% complete. The owner's brother had been staining in the pool area the day before the fire, stain rags were found laid out by the pool. The owners brother provided a diagram which identified the work area and location of the stain cans.

The area of origin was the first-floor center of the structure, there was a limited fuel load. Appliances within the structure were not connected and in an adjoining room. The floor had holes burned through and had partially collapsed. Liberty Mutual had contractors shore up the floor. Samples were collected and came back negative. Investigator Hamilton had to return a couple of days after the fire to examine the basement as there was several feet of water in the basement from fire suppression.

Mark Shockman and Scot Russ of FEC investigated the claim for Liberty Mutual Insurance. The fire department participated in three joint scene examinations. During excavation, clean glass was found below a window at the rear of the structure and a gas can was recovered in close proximity. FEC sent the gas can for analysis and negative results were received. There were no mechanical or electrical devices found in the room of origin.

The fire department now has custody of the gas can. The FBI reached out to the fire department concerning crimes against a protected class, Agent Julie Becker jabecker2@fbi.gov. Investigator Hamilton stated the fire department has not concluded their investigation yet.

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

Investigator Hamilton was asked about the forcing of the door to the west of the great room. He could not confirm if the door was open or had been forced by the fire department. The Washington Township Fire Department has possession of the gas can.

Investigators Note-Kevin Sanders of EFI requested statements from witnesses and firefighters as well as the opportunity to photograph any evidence recovered. Investigator Hamilton consulted with the Legal Department and the request was denied.

Review of 911 Calls

Three 911 Calls were received by the Northwest Regional Communications Center. There was no date or time information attached to call recordings.

Caller 1 was Dene Sanfillipo, neighbor at 5241 Locust Hill who reported she turned onto the street and saw “major flames entire top of house, looks like it is ready to collapse”.

Caller 2 was Chad Collins, who was driving by on Dublin Rd. reported “whole top floor involved”.

Caller 3 was Kimberly Wolman, 5150 Dublin Rd. neighbor who reported she “smelled smoke, looked outside and saw flames at top of house”.

Review of Ring Doorbell Video

The Ring Doorbell footage consisted of seven individual videos that were approximately three seconds each. The footage was taken from 5309 Dublin Rd. Dublin, Ohio which is located across the street to the northwest of 5281 Locust Hill Lane.

Ring Video 1, according to the Meta Data, was created on February 9, 2021 at 11:28p.m. At the immediate beginning of the video a rear light that shuts off is seen at 5300 Locust Hill Lane and there is a car in the driveway pulled up to the house. A flash can be seen mid-way up a first-floor window that appears to be from the rear interior towards the center of the structure at 5281 Locust Hill that rapidly erupts to fire showing through the visible first floor windows.



Figure 2: Car in driveway 5300 Locust Hill

Ring Video 2, according to the Meta Data, was created on February 9, 2021 at 11:43p.m. Showed fire throughout first floor and smoke on the exterior. Car still visible in driveway of 5300 Locust Hill Lane.

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

Ring Video 3, according to the Meta Data, was created on February 9, 2021 at 11:58p.m. Showed the fire dying down on the first floor possibly with severe interior smoke conditions. Increasing exterior smoke. Car still visible in driveway of 5300 Locust Hill Lane.

Ring Video 4, according to the Meta Data, was created on February 10, 2021 at 12:13a.m. Showed a large eruption of fire throughout the first and second floors. Smoke is visible at the yard of 5309 Dublin Rd. Car still visible in driveway of 5300 Locust Hill Lane.

Ring Video 5, according to the Meta Data, was created on February 10, 2021 at 12:28a.m. Showed the fire Department established on scene. Car is no longer visible in driveway of 5300 Locust Hill Lane.

Ring Video 6, according to the Meta Data, was created on February 10, 2021 at 12:43a.m. Fire Department on scene.

Ring Video 7, according to the Meta Data, was created on February 10, 2021 at 12:58a.m. Fire Department on scene.

ANALYSIS

Fire Origin Analysis

As fire develops, the production of heat and smoke create various fire effects, including mass loss, charring, deformation, lines of demarcation, arc sites on electrical wiring, and many others¹. These effects create recognizable patterns that are utilized with fire dynamics to identify the spread of fire throughout a structure. Observations of the fire by witnesses and first responders provide additional data for analysis and understanding of the fire's development.

The timeline created by the review of the Ring Doorbell videos established the fire started and appeared to be from the rear interior towards the center of the structure at approximately 11:28p.m. and accelerated across the first floor toward the west at a rapid rate (under three seconds), and at a lower level. Ring Video 3 depicts the fire dying down with increasing smoke conditions. Ring Video 4 shows a large eruption of fire. This sequence would be caused by the buildup of smoke and hot gasses decreasing the flames, then a sudden introduction of air possibly from additional windows becoming compromised. The 6mph northerly wind would have assisted in pushing the fire toward the interior of the structure.

Fire patterns throughout the interior in the form of calcified drywall decreased in intensity to burned paint, and then soot deposition on the walls decreased to the east and west away from the great room.

Mass loss of the roof structure, great room walls, and the second floor of the structure was greatest in the immediate area of the great room and formed movement and intensity patterns establishing fire development from the great room. This damage formed a radial fire pattern that extended from the south side center toward the north or front of the structure. Mass loss of material of the single-story roof sections on either side of the center diminished to an intact charred roof structure at the west. Roof damage on the east end of the structure did not extend past the second story section and intensified toward the great room.

¹ NFPA 921 Guide for Fire and Explosion Investigations, 2021 edition, §6.2.1

An irregular shaped fire pattern on the plywood subfloor extended from the west end of the curtain wall in almost a “Y” shape from the west side of the curtain wall toward the north east and north west areas of the great room. The irregular shaped pattern extended down the west hallway and stopped midway down.

The fire originated at the irregular shaped fire pattern located on the great room sub flooring and extended along the pattern throughout the first floor. As smoke and hot gasses built up and ignited, the fire extended to the second floor, and first floor attic areas. This sequence coincides with the footage contained in Ring Video’s 3 and 4. In comparing the Ring Video times and the fire report times the fire burned undetected for approximately forty-nine minutes.

Fire Cause Analysis

The analysis of a fire to determine cause involves consideration of the factors necessary for the fire to occur. These factors include an examination of potential ignition sources, potential fuels, and the circumstances that allowed those factors to come together and start the fire².

There were no adverse weather conditions that would have contributed to the fire’s ignition.

New receptacles had not yet been installed in the room. There were no electrical appliances reported to be in the room at the time of the fire. An existing receptacle was found with fire exposure damage, this receptacle was on the outer portion of the fire pattern extending up the wall from the consumed floor area near the basement steps and had no evidence of a fire originating from it.

Investigator Hamilton stated that a gas can was found near the west end of the curtain wall. They believed the west window had been broken as clean glass was found at the base. During the EFI review of the Washington Township scene photos the west end window showed a different breakage pattern compared to the adjacent windows. Clean glass was found on the floor and collected as evidence during the EFI examination. The door located to the west of the curtain wall had evidence of forced entry and was found to be open in the fire department photos. Investigator Hamilton did not recall any mention of the door being forced. It is unknown if this door had been forced prior to or after the fire department’s arrival. Investigator Hamilton stated the door to the east to the pool room was able to be pushed open and was not latched. During the EFI examination this door was secured with a battery-operated electronic lock that automatically locked and functioned properly. Scott Hamilton confirmed it was the same lock on the door. The east end of the structure had the least amount of damage, and the pool room only had light smoke damage. Either door could have provided a route of egress during the fire.

Clean glass found during the examinations is evidence that the glass was broken prior to the fire’s ignition. Had the glass been broken as a result of the fire or suppression activities smoke and soot accumulations would be present on the interior facing side.

Scott, Keith, and Colton Hamilton all stated there was no gas can or gas operated equipment on the property. Additionally, there was no evidence found of gasoline operated equipment at the property during the examination. The only flammable liquids at the property were two stain cans and possibly brush cleaning solvents that would have been in the room adjacent to the pool. The fire department recovered two stain cans from the

² NFPA 921 Guide for Fire and Explosion Investigations, 2021 edition, §19.1

second-floor debris. These cans were present at the EFI examination and were fire damaged but sealed, and both still contained product.

The timeline created by the review of the Ring Doorbell videos identified a fire at mid-window height at approximately 11:28p.m. and accelerated across the first floor at a rapid rate, and lower level within approximately three seconds. Wooden structural components and ordinary combustibles would not have had enough time to heat up, give off vapors and ignite across the structure within a three second time frame.

The rapid spread of the fire witnessed in the video recordings would be consistent with the use of an ignitable liquid. Additionally, the irregular floor pattern absent any identifiable fuel load was also consistent with the use of an ignitable liquid as a trailer to spread the fire between areas or rooms.

A trailer³ is a deliberately introduced fuel or manipulation of existing fuel(s) used to aid the spread of a fire from one area to another.

Confirmation⁴ of the presence of a trailer is a compelling indication that the fire was incendiary.

On September 28, 2021, a laboratory report was received stating debris samples 1-5 tested negative for the presence of ignitable liquids. Negative samples do not preclude the possibility that an ignitable liquid was utilized and subsequently consumed by the fire. The Washington Township Fire report indicates five master stream devices were in use during the suppression of the fire. Each would have the capability of flowing 1,000 gallons of water per minute. This quantity of water over an extended period would certainly dilute any remaining residue. Additionally, nearly seven months passed from the time of the fire and the EFI examination. With no roof over the area of origin, the summertime weather elements contributed to the degradation of any potential remaining residue.

There was an ongoing dispute with the neighborhood and the City of Dublin regarding the structure's use as a residential assisted care home for seniors.

During the EFI examination two potential points of unauthorized entry were identified.

A car was found parked in the driveway of 5300 Locust Hill Lane and a light, possibly motion detected, was visible going off. The car had left the property between Ring Video 4 and Ring Video 5 which coincides with the 911 call and the approximate time sirens would likely have been heard. Scott, Colton, and Keith Hamilton all stated the neighbor at 5300 was a snowbird and was in Florida at the time of the fire.

Both Liberty Mutual Insurance and the sub-contractor's insurance provided documentation to Mr. Hamilton stating that the fire was incendiary and was committed by unknown person(s). Neither Insurance company requested a report from their investigators.

Consideration was given for potential sources of ignition that can be destroyed by the fire or removed from the scene, such as from a match or lighter introduced via human action⁵. The introduction of a heat source, such as an open flame to combustible and/or flammable materials to intentionally ignite a fire was identified as a

³ NFPA 921 Guide for Fire and Explosion Investigations, 2021 edition, §23.2.2

⁴ NFPA 921 Guide for Fire and Explosion Investigations, 2021 edition, §23.2.2.1

⁵ NFPA 921 Guide for Fire and Explosion Investigations, 2021 edition, §19.5.2

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

hypothesis for this fire's ignition sequence⁶. In consideration of all other data and analysis of all other potential ignition sequences, this hypothesis was identified as the only ignition scenario uniquely consistent with the data.

RECOMMENDATIONS

EFI Global's file is now closed with no further recommendations at this time.


LIMITATIONS

Our services were performed in the manner defined in the Assignment section of this report. The opinions contained within this report were limited to the circumstances associated with this loss, and are based on the expert's education, experience, and training. Should additional information or evidence become known, the author reserves the right to supplement the report as necessary. Any re-use of this report or the findings, conclusions, or recommendations presented herein without the express permission of EFI Global, Inc. is prohibited.



Kevin Sanders, IAAI-CFI, ECT, CFEI, CVFI
Branch Manager
License # 201311234045

Technical reviewed by:

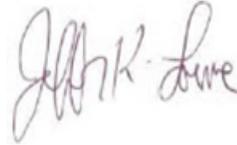

Jeffrey K. Lowe, IAAI-CFI
East Region Fire Sciences Principal

ATTACHMENTS

1. Photographs with captions
2. Diagram
3. Laboratory Report
4. Washington Township Fire Report
5. Dublin Police Report for Burglary and Fire
6. Weather Report

⁶ NFPA 921 Guide for Fire and Explosion Investigations, 2021 edition, §19.4.4.3

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 1

PHOTOGRAPHS

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 2

DIAGRAM

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 3
LABORATORY REPORT

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 4

WASHINGTON TOWNSHIP FIRE REPORT

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 5

DUBLIN POLICE REPORTS

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 6

WEATHER REPORT

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 1

PHOTOGRAPHS



Photo 1: Front, west end of structure.



Photo 2: Front and east end of structure.



Photo 3: Rear center. Pool room door.



Photo 3: Rear west end.



Photo 4: Pool room door, no evidence of forced entry.



Photo 5: Temporary wall across Great Room. Start of irregular fire pattern and location of clean broken glass.



Photo 6: Fire Department Photo. Great room curtain wall prior to collapse/removal. Possible window of entry circled. Door to left forced open by unknown.



Photo 7: Forced entry damage to rear door.



Photo 8: Rear door forcible entry damage, tool mark.



Photo 9: West hallway before debris removal.



Photo 10: Example of shoring supporting damaged floor under Great Room.



Photo 11: Irregular pattern on Great room floor taken from second floor.



Photo 12: West hallway after debris removal, exposing irregular fire pattern and floor level burning.


Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 2

DIAGRAM

5281 Locust Hill Ln. Dublin, OH 43016

EFI File No.: 019.02004

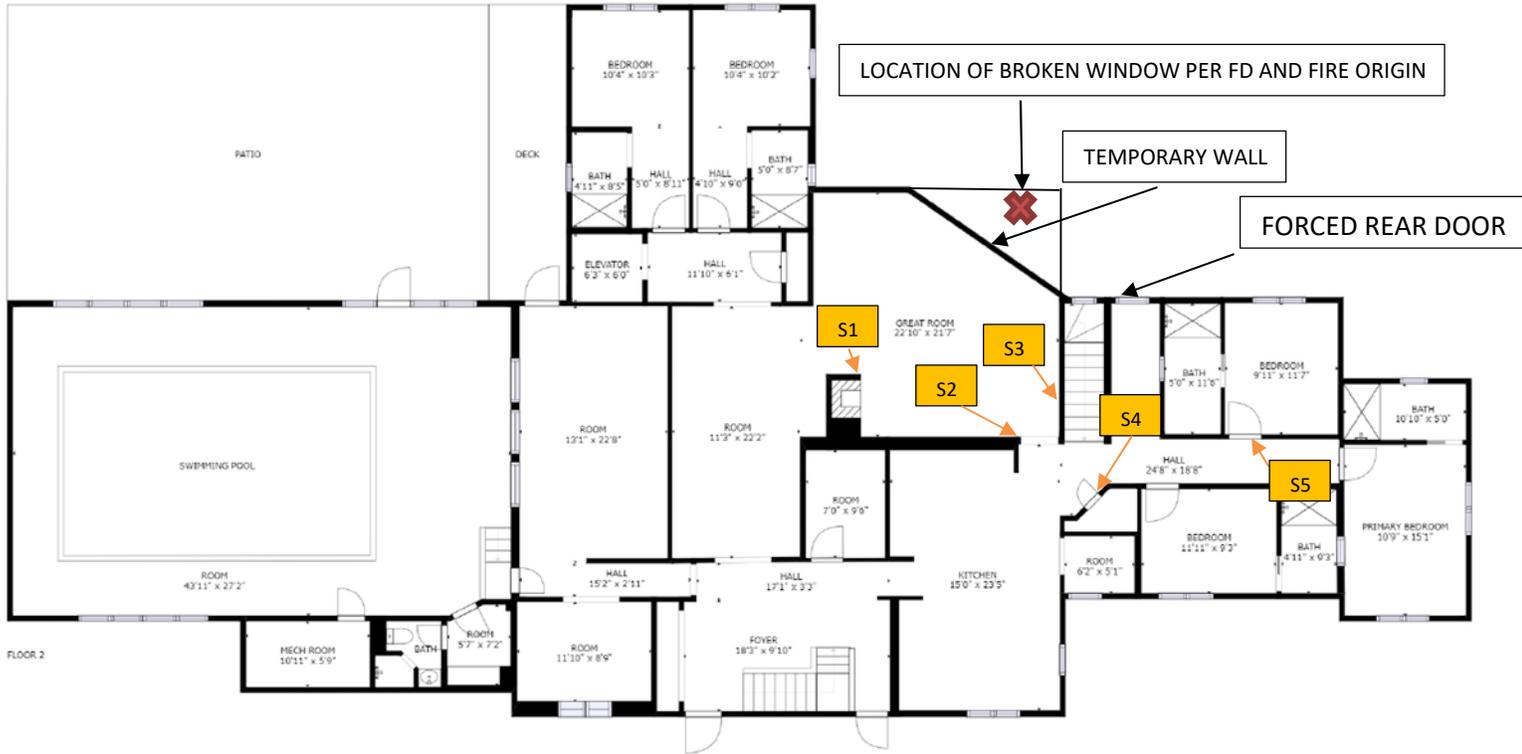


NOT TO SCALE

This diagram is for illustrative purposes only

5281 Locust Hill Lane Dublin, Ohio 43017

EFI File No.: 019.02004

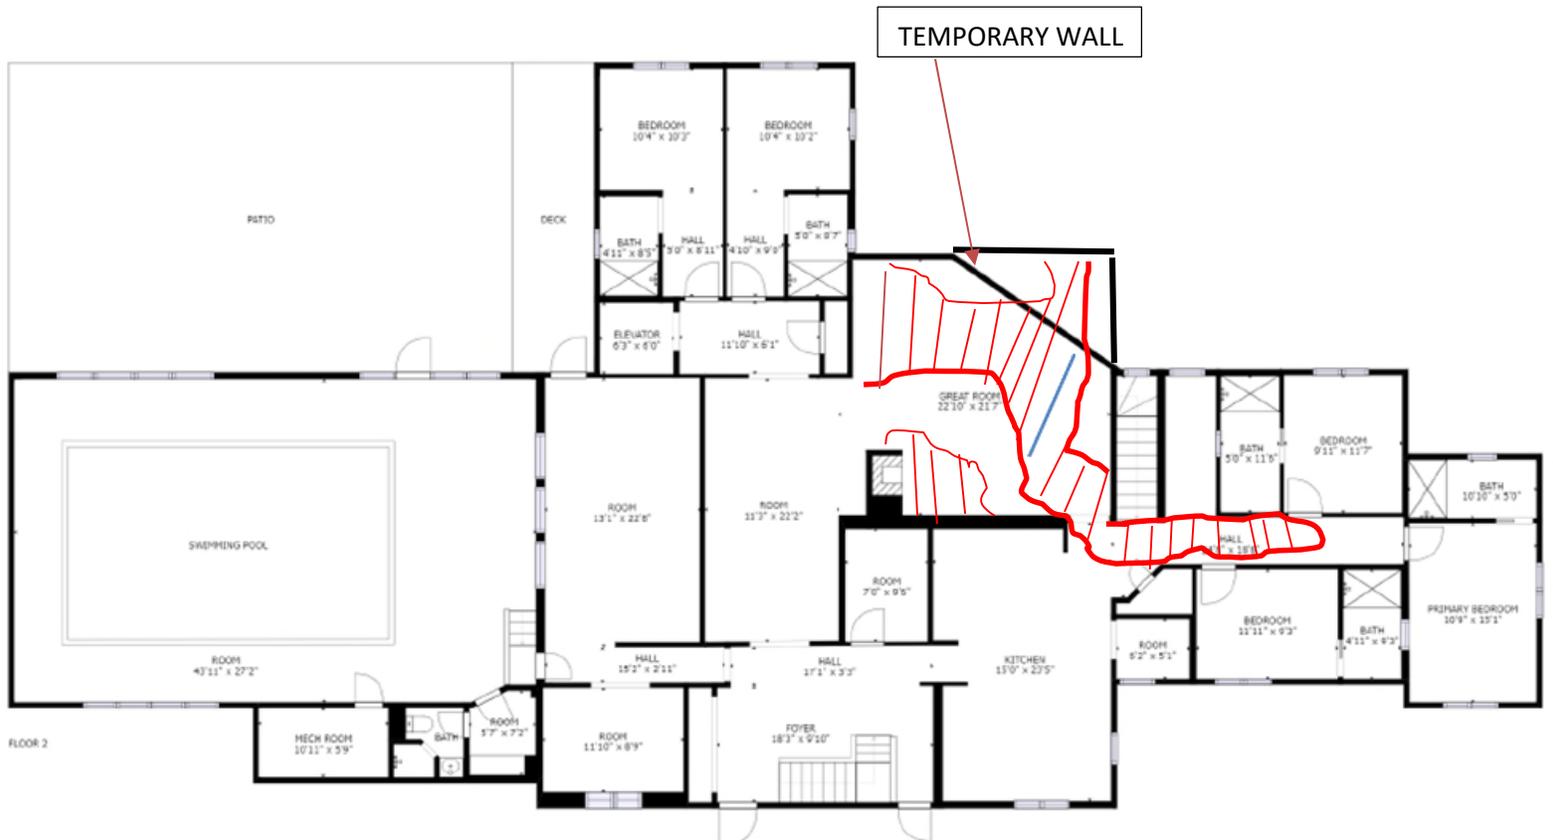

NOT TO SCALE

This diagram is for illustrative purposes only

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 3
LABORATORY REPORT



Forensic Laboratory Report

EFI Global File No: 019.02004

September 28, 2021

Insured: Ottercreek Group, LLC
5281 Locust Hill Lane
Dublin, OH 43017

Prepared For: Scott Hamilton, Ottercreek Group, LLC
Address 21865 Shirk Road
City, State Zip Marysville, OH 43040

Date of Loss: 02-10-21

Claim No.: N/A

EVIDENCE SUBMITTED AND TESTING RESULTS

On September 27, 2021, five samples were submitted to the EFI Global Laboratory by investigator Kevin Sanders via FedEx. It was requested the samples be analyzed for the presence of identifiable ignitable liquid residues.

Item	Evidence Description	Location	Result
1)	Fire Debris	East Great Room	Negative
2)	Fire Debris	Northwest Great Room Entry	Negative
3)	Fire Debris	West Wall Great Room	Negative
4)	Fire Debris	East End Hallway	Negative
5)	Fire Debris	West End Hallway	Negative

The samples will be stored by EFI Global until written authorization for disposal or transfer of the evidence is received. Due to the corrosive nature of some fire debris, container integrity cannot be guaranteed for prolonged storage.

ANALYSIS PERFORMED

The samples were tested utilizing passive headspace concentration utilizing charcoal absorption of vapor concentration (ASTM E1412-19) and analyzed utilizing gas chromatography-mass spectrometry (GC-MS) following the methodology of ASTM E1618-19. The spectra obtained were compared to known ILR standards and to the National Institute of Standards and Technology (NIST) Database.

CONCLUSIONS

The samples did not contain measurable levels of ignitable liquids. Please note: negative results do not preclude the presence of ignitable liquids at the time of the loss.

If you have any questions or require additional information, please do not hesitate to contact us at 916-316-3316.

Respectfully submitted:

Reviewed by:

Smith Purdum
Chemical Laboratory Specialist

David Brien
Chemical Laboratory Manager

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 4

WASHINGTON TOWNSHIP FIRE REPORT

A Delete Change No Activity **NFIRS -1 Basic**

25013 * FDID * OH State * 02 MM 10 DD 2021 YYYY * 91 Station * 21-0000566 Incident Number * 000 Exposure * 0062 Census Tract - 20

B Location* Check this box to indicate that the address for this incident is provided on the Wildland Fire Module in Section B "Alternative Location Specification". Use only for Wildland fires.

Street address Intersection In front of Rear of Adjacent to Directions

5281 Number/Milepost Locust Hill Street or Highway LN Street Type

Dublin City OH State 43016 Zip Code

Cross street or directions, as applicable

C Incident Type* 111 Building fire

E1 Date & Times Midnight is 0000

Check boxes if dates are the same as Alarm Date. ALARM always required

Alarm * 02 10 2021 00:17:02

ARRIVAL required, unless canceled or did not arrive

Arrival * 02 10 2021 00:22:57

CONTROLLED Optional, Except for wildland fires

Controlled

LAST UNIT CLEARED, required except for wildland fires

Last Unit Cleared 02 10 2021 16:22:51

E2 Shift & Alarms Local Option 1 01 95

Shift or Alarms District Platoon

D Aid Given or Received*

1 Mutual aid received Automatic aid received Mutual aid given Automatic aid given Other aid given None

25123 OH Their FDID Their State

25123 Their Incident Number

E3 Special Studies Local Option 9244 3

Special Study ID# Special Study Value

F Actions Taken* 11 Extinguishment by fire

Primary Action Taken (1)

Additional Action Taken (2)

Additional Action Taken (3)

G1 Resources* Check this box and skip this section if an Apparatus or Personnel form is used.

Apparatus 0016 Personnel 0037

EMS Other

Check box if resource counts include aid received resources.

G2 Estimated Dollar Losses & Values LOSSES: Required for all fires if known. Optional for non fires. None

Property \$ 803,791

Contents \$ 141,845

PRE-INCIDENT VALUE: Optional

Property \$ 945,636

Contents \$ 141,845

Completed Modules Fire-2 Structure-3 Civil Fire Cas.-4 Fire Serv. Cas.-5 EMS-6 HazMat-7 Wildland Fire-8 Apparatus-9 Personnel-10 Arson-11

H1* Casualties None Deaths Injuries

Fire Service Civilian

H2 Detector Required for Confined Fires.

1 Detector alerted occupants Detector did not alert them Unknown

H3 Hazardous Materials Release

None

1 Natural Gas: slow leak, no evaluation or HazMat actions

2 Propane gas: <21 lb. tank (as in home BBQ grill)

3 Gasoline: vehicle fuel tank or portable container

4 Kerosene: fuel burning equipment or portable storage

5 Diesel fuel/fuel oil: vehicle fuel tank or portable

6 Household solvents: home/office spill, cleanup only

7 Motor oil: from engine or portable container

8 Paint: from paint cans totaling < 55 gallons

0 Other: Special HazMat actions required or spill > 55gal., Please complete the HazMat form

I Mixed Use Property

Not Mixed Assembly use Education use Medical use Residential use Row of stores Enclosed mall Bus. & Residential Office use Industrial use Military use Farm use Other mixed use

J Property Use* Structures

131 Church, place of worship

161 Restaurant or cafeteria

162 Bar/Tavern or nightclub

213 Elementary school or kindergarten

215 High school or junior high

241 College, adult education

311 Care facility for the aged

331 Hospital

341 Clinic, clinic type infirmary

342 Doctor/dentist office

361 Prison or jail, not juvenile

419 1-or 2-family dwelling

429 Multi-family dwelling

439 Rooming/boarding house

449 Commercial hotel or motel

459 Residential, board and care

464 Dormitory/barracks

519 Food and beverage sales

539 Household goods, sales, repairs

579 Motor vehicle/boat sales/repair

571 Gas or service station

599 Business office

615 Electric generating plant

629 Laboratory/science lab

700 Manufacturing plant

819 Livestock/poultry storage (barn)

882 Non-residential parking garage

891 Warehouse

936 Vacant lot

938 Graded/care for plot of land

946 Lake, river, stream

951 Railroad right of way

960 Other street

961 Highway/divided highway

962 Residential street/driveway

981 Construction site

984 Industrial plant yard

Lookup and enter a Property Use code only if you have NOT checked a Property Use box:

Property Use 459

Residential board and care

NFIRS-1 Revision 03/11/99

K1 Person/Entity Involved

Local Option _____ Business name (if applicable) _____ Area Code _____ Phone Number _____

Check This Box if same address as incident location. Then skip the three duplicate address lines.

Mr., Ms., Mrs. First Name _____ MI _____ Last Name _____ Suffix _____

Number _____ Prefix _____ Street or Highway _____ Street Type _____ Suffix _____

Post Office Box _____ Apt./Suite/Room _____ City _____

State _____ Zip Code _____

More people involved? Check this box and attach Supplemental Forms (NFIRS-1S) as necessary

K2 Owner

Local Option _____ Business name (if Applicable) _____ Area Code _____ Phone Number _____

Same as person involved? Then check this box and skip The rest of this section.

Check this box if same address as incident location. Then skip the three duplicate address lines.

Mr., Ms., Mrs. First Name _____ MI _____ Last Name _____ Suffix _____

Number _____ Prefix _____ Street or Highway _____ Street Type _____ Suffix _____

Post Office Box _____ Apt./Suite/Room _____ City _____

State _____ Zip Code _____

L Remarks

Local Option

02/12/2021 06:51:57 PM tharris

Washington units dispatched to the listed address on the report of smoke coming from the roof of a structure. After getting enroute BN91 received radio traffic from NRECC that the report was updated to flames through the roof with the roof looking like it was going to collapse. BN91 made the response upgraded to a working fire incident. The time was approximately 0020 with a temp of 11F. E95 was the first piece to mark on scene with a size up of a large residential structure, heavy smoke and fire showing on the second floor, signs of active construction on the property with a large dumpster in front, completing a 360 and stretching an attack line. BN91 arrived shortly after E95 and assumed command, stated that we would be in the defensive strategy. Command then contacted L91 and advised them to place their vehicle on the delta side and prepare for elevated operations. E95 initiated an exterior attack with a hand line and tank water. E95 officer contacted E92 and told them to set up water supply to E95. As L91 had just arrived Command diverted E92 to supply L91 and then to E95. E91 arrived and parked behind E92 and supplied manpower. SQ91 crew assisted L91 in the bucket, M95 crew dressed and took assignments, M92 crew was the fire ground medic. P94 contacted command and gave information on the structure and the compartmentation hazards. He also advised that the structure had a sprinkler connection but was unsure of the serviceability. Crews on scene believed that no sprinkler activation had occurred with the advanced state of the fire. It was also noted that no strobes or audible alarms were sounding either. The structure was in the process of being converted into a group home for the elderly. Crews had two master stream Mercury nozzles working from the ground, 1 on Alpha, 1 on Charlie. There were two master streams flowing from the elevated ladder. This attack was making little headway. Command called for L81 to respond. On their arrival command had L81 raise and they also began two elevated master streams. Other hand lines were

L Authorization

212 Harris, Jr., Thomas L BCP 02 10 2021
 Officer in charge ID Signature Position or rank Assignment Month Day Year

Check Box if same as Officer in charge. 212 Harris, Jr., Thomas L BCP 02 12 2021
 Member making report ID Signature Position or rank Assignment Month Day Year

25013
FDID *

OH
State *

MM DD
2 10
Incident Date *

YYYY
2021

91
Station

21-0000566
Incident Number *

000
Exposure *

Complete
Narrative

Narrative:

02/12/2021 06:51:57 PM tharris

Washington units dispatched to the listed address on the report of smoke coming from the roof of a structure. After getting enroute BN91 received radio traffic from NRECC that the report was updated to flames through the roof with the roof looking like it was going to collapse. BN91 made the response upgraded to a working fire incident. The time was approximately 0020 with a temp of 11F. E95 was the first piece to mark on scene with a size up of a large residential structure, heavy smoke and fire showing on the second floor, signs of active construction on the property with a large dumpster in front, completing a 360 and stretching an attack line. BN91 arrived shortly after E95 and assumed command, stated that we would be in the defensive strategy. Command then contacted L91 and advised them to place their vehicle on the delta side and prepare for elevated operations. E95 initiated an exterior attack with a hand line and tank water. E95 officer contacted E92 and told them to set up water supply to E95. As L91 had just arrived Command diverted E92 to supply L91 and then to E95. E91 arrived and parked behind E92 and supplied manpower. SQ91 crew assisted L91 in the bucket, M95 crew dressed and took assignments, M92 crew was the fire ground medic. P94 contacted command and gave information on the structure and the compartmentation hazards. He also advised that the structure had a sprinkler connection but was unsure of the serviceability. Crews on scene believed that no sprinkler activation had occurred with the advanced state of the fire. It was also noted that no strobes or audible alarms were sounding either. The structure was in the process of being converted into a group home for the elderly. Crews had two master stream Mercury nozzles working from the ground, 1 on Alpha, 1 on Charlie. There were two master streams flowing from the elevated ladder. This attack was making little headway. Command called for L81 to respond. On their arrival command had L81 raise and they also began two elevated master streams. Other hand lines were in place knocking down smaller spot fires. Fire progressed through the majority of the structure. There was a large indoor pool area filled with construction materials that was saved from the fire. All streams were flowing for approximately 1 hour and 45 minutes. Gas and electric were shut off early into the fire. P94 arrived and provided technical assistance with the structure. The sprinkler connection was accessed and charged but appeared not to flow water so it was disconnected. Eventually, all water operations were ceased and command and crews reassessed the structure. At that time there were only a few spot fires that were attacked with firefighters by making entry in to safe portions of the structure. Situation was contained and companies began to be released. Q93 and E83 were called to the scene to assist crews with clean up and then stay for fire watch. Q93 continued to extinguish small fires until shift change, at which time E95 crew from 2 Unit came to the scene to maintain it for prevention and their investigation. There was never an actual primary or secondary preformed due to the extent of the fire and the fact that the building was under renovation. There were no firefighter injuries. There may be additions to this report.

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 5

DUBLIN POLICE REPORTS



City of Dublin
POLICE

Email Cover Sheet

Phone: (614) 410-4800 **Fax:** (614) 410-4947

To: Matthew Decker
matthew.decker@efiglobal.com

Attached are the records you requested on the location

5281 Locust Hill Lane, Dublin, OH 43017

COMMUNICATIONS

Event Report

Event ID: 0201-160-096 Call Ref #: 28 Date/Time Received: 04/25/20 02:32:50

Rpt #: Prime 153

Call Source: SELF	Unit: KEEHL, MATHEW D	Services Involved
		LAW

Location: 5281 LOCUST HILL LN

X-ST: DUBLIN RD

Jur: CAD Service: LAW Agency: DPD
St/Beat: D1 District: RA:
Phone: GP: D101

Nature: 61-HOUSE CHECK Alarm Lvl: 1 Priority: 5 Medical Priority:

Reclassified Nature:

Caller: Alarm:
Addr: Alarm Type:
Phone: Alarm Type:

Vehicle #: St: OH Report Only: No Race: Sex: Age:

Call Taker: Unit:153 Console: 8119

Geo-Verified Addr.: Yes Nature Summary Code: Disposition: M Close Comments:

Notes:

Times

Call Received: 04/25/20 02:32:50	Time From Call Received	Unit Reaction: (1st Dispatch to 1st Arrive)
Call Routed: 04/25/20 02:32:50		En-Route: (1st Dispatch to 1st En-Route)
Call Take Finished: 04/25/20 02:32:50		On-Scene: 000:03:02 (1st Arrive to Last Clear)
1st Dispatch: 04/25/20 02:32:50	(Time Held)	
1st En-Route: 04/25/20 02:32:50	(Reaction Time)	
1st Arrive: 04/25/20 02:32:50		
Last Clear: 04/25/20 02:35:52	000:03:02	

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
153	4973	DXY	DispatchXY	04/25/20 02:32:50	1796802.94,756731.17		Unit: 153
153	4973	D	Dispatched	04/25/20 02:32:50	Stat/Beat: D1		Unit: 153
153	4973	E	En-Route	04/25/20 02:32:50	Stat/Beat: D1		Unit: 153
153	4973	A	Arrived	04/25/20 02:32:50	Stat/Beat: D1		Unit: 153
153	4973	AAT	Auto Arrive Timestamp	04/25/20 02:32:52	Current status is:A. Offset of 0 seconds.		KEEHMD
153	4973	C	Cleared	04/25/20 02:35:52		M	KEEHMD

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TR	Time Received	04/25/20 02:32:50	By: SELF		Unit: 153
		FIN	Finished Call Taking	04/25/20 02:32:50			Unit: 153

Employee Info

Unit	Empl ID	Name
153	4973	KEEHL, MATHEW D

COMMUNICATIONS

Event Report

Event ID: 0201-170-216 Call Ref #: 639 Date/Time Received: 04/26/20 12:14:23

Rpt #: Prime 124 Services Involved
Call Source: SELF Unit: BYERS, THOMAS ERIC

LAW			
-----	--	--	--

Location: 5281 LOCUST HILL LN
X-ST: DUBLIN RD Jur: CAD Service: LAW Agency: DPD
Business: St/Beat: D1 District: RA: GP: D101
Phone: Phone:

Nature: 61-HOUSE CHECK Alarm Lvl: 1 Priority: 5 Medical Priority:

Reclassified Nature:

Caller: Alarm:
Addr: Alarm Type:
Phone: Phone:

Vehicle #: St: OH Report Only: No Race: Sex: Age:

Call Taker: Unit:124 Console: 8115

Geo-Verified Addr.: Yes Nature Summary Code: Disposition: M Close Comments:

Notes:

		Times
Call Received:	04/26/20 12:14:23	Time From Call Received
Call Routed:	04/26/20 12:14:24	000:00:01 Unit Reaction: (1st Dispatch to 1st Arrive)
Call Take Finished:	04/26/20 12:14:24	000:00:01 En-Route: (1st Dispatch to 1st En-Route)
1st Dispatch:	04/26/20 12:14:24	000:00:01 (Time Held) On-Scene: 000:06:53 (1st Arrive to Last Clear)
1st En-Route:	04/26/20 12:14:24	000:00:01
1st Arrive:	04/26/20 12:14:24	000:00:01 (Reaction Time)
Last Clear:	04/26/20 12:21:17	000:06:54

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
124	3309	DXY	DispatchXY	04/26/20 12:14:24	1793737.28,765185.41		Unit:124
124	3309	D	Dispatched	04/26/20 12:14:24	Stat/Beat: D1		Unit:124
124	3309	E	En-Route	04/26/20 12:14:24	Stat/Beat: D1		Unit:124
124	3309	A	Arrived	04/26/20 12:14:24	Stat/Beat: D1		Unit:124
124	3309	AAT	Auto Arrive Timestamp	04/26/20 12:17:40	Current status is:A. Offset of 0 seconds.		BYERTE
124	3309	C	Cleared	04/26/20 12:21:17		M	BYERTE

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TR	Time Received	04/26/20 12:14:23	By: SELF		Unit:124
		FIN	Finished Call Taking	04/26/20 12:14:24			Unit:124

Employee Info

Unit	Empl ID	Name
124	3309	BYERS, THOMAS ERIC

COMMUNICATIONS

Event Report

Event ID: 0201-170-070 Call Ref #: 492 Date/Time Received: 04/26/20 02:18:48

Rpt #: Prime 129

Call Source: SELF

Unit: ARONOVIC, DAVID E

LAW

Services Involved

Location: 5281 LOCUST HILL LN

X-ST: DUBLIN RD

Jur: CAD Service: LAW Agency: DPD

SI/Beat: D1 District: RA:

Business: Phone: GP: D101

Nature: 61-HOUSE CHECK Alarm Lvl: 1 Priority: 5 Medical Priority:

Reclassified Nature:

Caller: Alarm: Alarm Type:
Addr: Phone: Alarm Type:

Vehicle #: St: OH Report Only: No Race: Sex: Age:

Call Taker: Unit: 129 Console: 8103

Geo-Verified Addr.: Yes Nature Summary Code: Disposition: M Close Comments:

Notes:

Times

Call Received:	04/26/20 02:18:48	Time From Call Received	
Call Routed:	04/26/20 02:18:48	Unit Reaction:	000:01:04 (1st Dispatch to 1st Arrive)
Call Take Finished:	04/26/20 02:18:48	En-Route:	(1st Dispatch to 1st En-Route)
1st Dispatch:	04/26/20 02:18:48	On-Scene:	000:01:47 (1st Arrive to Last Clear)
1st En-Route:	04/26/20 02:18:48		
1st Arrive:	04/26/20 02:19:52		
Last Clear:	04/26/20 02:21:39		

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
129	4646	DXY	DispatchXY	04/26/20 02:18:48	1795433.71,757457.16		Unit:129
129	4646	D	Dispatched	04/26/20 02:18:48	Stat/Beat: D1		Unit:129
129	4646	E	En-Route	04/26/20 02:18:48	Stat/Beat: D1		Unit:129
129	4646	AET	Auto Enroute Timestam	04/26/20 02:18:52	Current status is:E. Offset of 1 seconds.		ARONDE
129	4646	A	Arrived	04/26/20 02:19:52	Auto-arriving with offset of 0 seconds.		ARONDE
129	4646	C	Cleared	04/26/20 02:21:39		M	ARONDE

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TR	Time Received	04/26/20 02:18:48	By: SELF		Unit:129
		FIN	Finished Call Taking	04/26/20 02:18:48			Unit:129

Employee Info

Unit 129 Empl ID 4646 Name ARONOVIC, DAVID E

COMMUNICATIONS

Event Report

Event ID: 0203-370-093 Call Ref #: 831 Date/Time Received: 12/02/20 06:54:30

Rpt #: 20-002393 Prime 159
Call Source: PHONE Unit: KIRBY, JOSHUA M

LAW									
-----	--	--	--	--	--	--	--	--	--

Services Involved

Location: 5281 LOCUST HILL LN

X-ST: DUBLIN RD Jur: CAD Service: LAW Agency: DPD
Business: St/Beat: D1 District: RA:
Phone: Phone: GP: D101

Nature: 12-BURGLARY Alarm Lvl: 1 Priority: 5 Medical Priority:

Reclassified Nature:

Caller: MCMILLEN, TOM E
Addr: 30 S VINE ST

Phone:  Alarm:
Alarm Type:

Vehicle #: St: Report Only: No Race: Sex: Age:
Call Taker: HYLTVL Console: DISPCON9

Geo-Verified Addr.: Yes Nature Summary Code: PASS Disposition: RM Close Comments:

Notes: UDTs: SUPV NOTIFIED RUN HOLDING [12/02/20 06:55:43 GOLDBA]
occ over night. tools are missing from construction inside the house. [12/02/20 06:55:04 HYLTVL]

Times

	Time From Call Received	Unit Reaction:	000:06:23 (1st Dispatch to 1st Arrive)
Call Received:	12/02/20 06:54:30		
Call Routed:	12/02/20 06:55:25		
Call Take Finished:	12/02/20 06:55:25	En-Route:	(1st Dispatch to 1st En-Route)
1st Dispatch:	12/02/20 07:45:05	On-Scene:	000:34:22 (1st Arrive to Last Clear)
1st En-Route:	12/02/20 07:45:05		
1st Arrive:	12/02/20 07:51:28		
Last Clear:	12/02/20 08:25:50		

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
159	5098	DXY	DispatchXY	12/02/20 07:45:05	1791292.33,763952.99		KIRBJM
159	5098	D	Dispatched	12/02/20 07:45:05	Stat/Beat: D4		KIRBJM
159	5098	E	En-Route	12/02/20 07:45:05	Stat/Beat: D4		KIRBJM
159	5098	AET	Auto Enroute Timestam	12/02/20 07:45:07	Current status is:E. Offset of 1 seconds.		KIRBJM
159	5098	A	Arrived	12/02/20 07:51:28	Auto-arriving with offset of 0 seconds.		KIRBJM
159	5098	C	Cleared	12/02/20 08:25:50		RM	KIRBJM

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TR	Time Received	12/02/20 06:54:30	By: PHONE		HYLTVL
		ENT	Entered Street	12/02/20 06:54:30	5281 LOCUST HILL LN		HYLTVL
		ENT	Entered Nature	12/02/20 06:54:39	12-BURGLARY		HYLTVL
		ENT	Entered Remarks	12/02/20 06:55:04			HYLTVL
		ENT	Entered CallerName Ca	12/02/20 06:55:11	MCMILLEN, TOM		HYLTVL
		ENT	Entered CallerPhone	12/02/20 06:55:21	[REDACTED]		HYLTVL
		FIN	Finished Call Taking	12/02/20 06:55:25			HYLTVL
		PAGE	Automatic Nature Page	12/02/20 06:55:26	Paged ZGDPD1		PAGESRV
		VEVT	Viewed Event	12/02/20 06:55:30	User First Viewed Event CAD		GOLDBA
		SNH	SUPV NOTIFIED RUN	12/02/20 06:55:43			GOLDBA
		ARM	Added Remarks	12/02/20 06:55:43			GOLDBA
		VEVT	Viewed Event	12/02/20 07:01:46	User First Viewed Event CAD		BURKCS
		ENT	Entered Caller Name	12/02/20 07:58:08	MCMILLEN, TOM E		GOLDBA
		ENT	Entered CallerStreetNo	12/02/20 07:58:10	ID: 7221011 30		GOLDBA
		ENT	Entered CallerStreet	12/02/20 07:58:11	ID: 7221011 S VINE		GOLDBA
		ENT	Entered CallerDob	12/02/20 07:58:15	ID: 7221011 8/4/1957		GOLDBA
		ENT	Entered CallerAge	12/02/20 07:58:15	ID: 7221011 63		GOLDBA
		ENT	Entered CallerRace	12/02/20 07:58:16	ID: 7221011 W		GOLDBA
		ENT	Entered CallerSex	12/02/20 07:58:16	ID: 7221011 M		GOLDBA
		ENT	Entered CallerHeight	12/02/20 07:58:17	ID: 7221011 600		GOLDBA
		CHG	Changed CallerWeight	12/02/20 07:58:18	ID: 7221011 0 --> 260		GOLDBA
		ENT	Entered CallerEyes	12/02/20 07:58:19	ID: 7221011 HAZ		GOLDBA
159	5098	RPT	Requested Report#	12/02/20 07:58:47	DPD Report #20-002393 Unit:159		KIRBJM
159	1466	RPT	Requested Report#	12/02/20 07:58:47	DPD Report #20-002393 Unit:159		KIRBJM
		ENT	Entered CallerOInState	12/02/20 07:58:59	ID: 7221011 OH		GOLDBA
		ENT	Entered CallerOIn	12/02/20 07:58:59	ID: 7221011 [REDACTED]		GOLDBA

Event ID: 0203-370-093 Call Ref #: 831 12-BURGLARY at 5281 LOCUST HILL LN

HIRSTE
GOLDBA

VEVT Viewed Event 12/02/20 08:09:02 User First Viewed Event CAD
RSW Reset Watchdog Timer 12/02/20 08:12:57 Units: 159 >>> 15Min.

Related Names

Last, First, MI Suffix Type Race Sex HT WT Eyes DOB Age Home / Mobile Ph Work Ph
McMillen, Tom E CALL W M 600 260 HAZ 08/04/57 63 [REDACTED]

Address: 30 S Vine St, Westerville, OH 43081

OIn: [REDACTED] OIn St: OH

Notes:

Employee Info

Unit	Empl ID	Name
159	1466	MILLER, JEREMY R
159	5098	KIRBY, JOSHUA M

COMMUNICATIONS

Event Report

Event ID: 0210-410-005 Call Ref #: 899 Date/Time Received: 02/10/21 00:17:37

Rpt #: Prime 189

Call Source: W911

Unit: HYSELL, NATHAN MARK

LAW	FIRE		
-----	------	--	--

Services Involved

Location: 5281 LOCUST HILL LN

X-ST: DUBLIN RD

Jur: CAD Service: LAW Agency: DPD

St/Beat: D1 District: RA:

Business: Phone: GP: D101

Nature: 28-FIRE RUN Alarm Lvl: 1 Priority: 5 Medical Priority:

Reclassified Nature:

Caller: DENAY
Addr:

Phone:  Alarm:
Alarm Type:

Vehicle #: St: Report Only: No Race: Sex: Age:

Call Taker: HYLTVL Console: DISPCON9

Geo-Verified Addr.: Yes Nature Summary Code: PASS Disposition: M Close Comments:

Notes:

See Event Notes Addendum at end of this report

Times

	Time From Call Received	
Call Received:	02/10/21 00:17:37	Unit Reaction: 000:04:20 (1st Dispatch to 1st Arrive)
Call Routed:	02/10/21 00:17:37	En-Route: (1st Dispatch to 1st En-Route)
Call Take Finished:	02/10/21 00:17:37	On-Scene: 010:06:41 (1st Arrive to Last Clear)
1st Dispatch:	02/10/21 00:17:52	
1st En-Route:	02/10/21 00:17:52	
1st Arrive:	02/10/21 00:22:12	
Last Clear:	02/10/21 10:28:53	

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
189	4208	DXY	DispatchXY	02/10/21 00:17:52	1789578.29,773585.60		HYLTVL
189	4208	D	Dispatched	02/10/21 00:17:52	Stat/Beat: DGN		HYLTVL
189	4208	E	En-Route	02/10/21 00:17:52	Stat/Beat: DGN		HYLTVL
171	4398	DXY	DispatchXY	02/10/21 00:17:52	1800957.52,772640.79		HYLTVL
171	4398	D	Dispatched	02/10/21 00:17:52	Stat/Beat: D2		HYLTVL
171	4398	E	En-Route	02/10/21 00:17:52	Stat/Beat: D2		HYLTVL
171	4398	AET	Auto Enroute Timestam	02/10/21 00:17:56	Current status is:E. Offset of 1 seconds.		BOULEK
189	4208	AET	Auto Enroute Timestam	02/10/21 00:17:56	Current status is:E. Offset of 1 seconds.		HYSENM
171	4398	A	Arrived	02/10/21 00:22:12	Auto-arriving with offset of 0 seconds.		BOULEK
189	4208	A	Arrived	02/10/21 00:23:01	Auto-arriving with offset of 0 seconds.		HYSENM
168	4116	DXY	DispatchXY	02/10/21 01:04:26	1783762.71,760550.46		HYLTVL
168	4116	D	Dispatched	02/10/21 01:04:26			HYLTVL
168	4116	E	En-Route	02/10/21 01:04:26			HYLTVL
168	4116	AET	Auto Enroute Timestam	02/10/21 01:04:29	Current status is:E. Offset of 1 seconds.		RAHDMR
168	4116	C	Cleared	02/10/21 01:04:55		M	RAHDMR
171	4398	C	Cleared	02/10/21 05:48:48		MB	BOULEK
102	1781	DXY	DispatchXY	02/10/21 05:49:00	1796906.10,755425.48		HYLTVL
102	1781	D	Dispatched	02/10/21 05:49:00	Stat/Beat: DSUP		HYLTVL
102	1781	E	En-Route	02/10/21 05:49:00	Stat/Beat: DSUP		HYLTVL
102	1781	A	Arrived	02/10/21 05:49:21	Auto-arriving with offset of 16 seconds.		RICCPJ
168	4116	DXY	DispatchXY	02/10/21 05:49:24	1788951.99,765623.17		HYLTVL
168	4116	D	Dispatched	02/10/21 05:49:24	Out Evt: [A] at 6565 COMMERCE PKWY		HYLTVL
168	4116	E	En-Route	02/10/21 05:49:24	Out Evt: [A] at 6565 COMMERCE PKWY		HYLTVL
168	4116	A	Arrived	02/10/21 05:56:29	Auto-arriving with offset of 16 seconds.		RAHDMR
189	4208	C	Cleared	02/10/21 05:56:50		M	HYSENM
171	4398	DXY	DispatchXY	02/10/21 06:19:29	1788919.99,765575.55		BOULEK
171	4398	D	Dispatched	02/10/21 06:19:29	Stat/Beat: D2		BOULEK
171	4398	E	En-Route	02/10/21 06:19:29	Stat/Beat: D2		BOULEK
189	4208	DXY	DispatchXY	02/10/21 06:20:05	1789263.99,766190.73		HYSENM
189	4208	D	Dispatched	02/10/21 06:20:05	Stat/Beat: DGN		HYSENM
189	4208	E	En-Route	02/10/21 06:20:05	Stat/Beat: DGN		HYSENM
189	4208	A	Arrived	02/10/21 06:26:18			Unit:189
189	4208	C	Cleared	02/10/21 06:30:57		M	HYSENM
171	4398	A	Arrived	02/10/21 06:31:12	Auto-arriving with offset of 17 seconds.		BOULEK
102	1781	L	Location Change	02/10/21 06:31:42	DPD		KARNBP
102	1781	X	Canceled	02/10/21 06:39:32	Pre-empted to Event # 956		Unit:102

Event Report

171	4398	L	Location Change	02/10/21 06:54:29	DUBLIN/MONAHAN		KARNBP
171	4398	A	Arrived	02/10/21 06:54:31			KARNBP
151	109	DXY	DispatchXY	02/10/21 07:22:41	1789860.24,766057.06		BEAMDM
151	109	D	Dispatched	02/10/21 07:22:41	Stat/Beat: D5		BEAMDM
151	109	E	En-Route	02/10/21 07:22:41	Stat/Beat: D5		BEAMDM
151	109	AET	Auto Enroute Timestam	02/10/21 07:22:46	Current status is:E. Offset of 1 seconds.		BEAMDM
116	1224	DXY	DispatchXY	02/10/21 07:23:42	1789159.60,766040.58		KARNBP
116	1224	D	Dispatched	02/10/21 07:23:42	Stat/Beat: D3		KARNBP
116	1224	E	En-Route	02/10/21 07:23:44			KARNBP
116	1224	AET	Auto Enroute Timestam	02/10/21 07:23:46	Current status is:E. Offset of 1 seconds.		KRUMSS
151	109	A	Arrived	02/10/21 07:27:40	Auto-arriving with offset of 16 seconds.		BEAMDM
168	4116	C	Cleared	02/10/21 07:30:02		MB	RAHDMR
116	1224	A	Arrived	02/10/21 07:32:42	Auto-arriving with offset of 0 seconds.		KRUMSS
171	4398	C	Cleared	02/10/21 07:38:47		MB	BOULEK
157	235	DXY	DispatchXY	02/10/21 08:27:58	1788863.80,765869.76		KARNBP
157	235	D	Dispatched	02/10/21 08:27:58	Stat/Beat: DCIT		KARNBP
157	235	E	En-Route	02/10/21 08:27:59			KARNBP
157	235	AET	Auto Enroute Timestam	02/10/21 08:45:55	Current status is:E. Offset of 1 seconds.		BROWSA
157	235	A	Arrived	02/10/21 08:55:18	Auto-arriving with offset of 0 seconds.		BROWSA
157	235	C	Cleared	02/10/21 10:21:51	M	M	KARNBP
151	109	C	Cleared	02/10/21 10:28:44		M	BEAMDM
116	1224	C	Cleared	02/10/21 10:28:53		M	KRUMSS

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TS	Time Spawned	02/10/21 00:17:37	Initial call received at 02/10/2021 00:16:14		HYLTVL
		PAGE	Automatic Nature Page	02/10/21 00:17:38	Paged ZGDPD1		PAGESRV
		VEVT	Viewed Event	02/10/21 00:17:40	User First Viewed Event CAD		HYLTVL
		ARM	Added Remarks	02/10/21 00:19:17	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 00:20:23			HYLTVL
		ARM	Added Remarks	02/10/21 00:20:23	Sent to: Linked Events		HYLTVL
		ARM	Added Remarks	02/10/21 00:20:42	Notes sent from FIRE event #210410004		CASEAM
		ARM	Added Remarks	02/10/21 00:20:46	Notes sent from FIRE event #210410004		HUNTLD
		GASC	GAS COMPANY NOTIF	02/10/21 00:21:18			HYLTVL
		ARM	Added Remarks	02/10/21 00:21:18			HYLTVL
		ARM	Added Remarks	02/10/21 00:21:18	Sent to: Linked Events		HYLTVL
		ARM	Added Remarks	02/10/21 00:21:27	Notes sent from FIRE event #210410004		HUNTLD
		ARM	Added Remarks	02/10/21 00:22:14	Notes sent from FIRE event #210410004		HUNTLD

ARM	Added Remarks	02/10/21 00:23:02	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:23:14	Notes sent from FIRE event #210410004	CONABL
VCHS	Viewed Call History	02/10/21 00:23:26	Location Information	HYLTVL
VCHS	Viewed Call History	02/10/21 00:23:28	Location Information	HYLTVL
ARM	Added Remarks	02/10/21 00:23:33	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:23:59	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:24:16	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:25:54	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:26:01	Notes sent from FIRE event #210410004	CASEAM
ARM	Added Remarks	02/10/21 00:26:31		HYLTVL
ARM	Added Remarks	02/10/21 00:26:31	Sent to: Linked Events	HYLTVL
ARM	Added Remarks	02/10/21 00:27:31	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:28:43	Notes sent from FIRE event #210410004	JOHNJL
ARM	Added Remarks	02/10/21 00:29:54	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:30:03	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:30:31		HYLTVL
ARM	Added Remarks	02/10/21 00:30:31	Sent to: Linked Events	HYLTVL
ARM	Added Remarks	02/10/21 00:30:34	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:30:55		HYLTVL
ARM	Added Remarks	02/10/21 00:30:55	Sent to: Linked Events	HYLTVL
ARM	Added Remarks	02/10/21 00:31:15		HYLTVL
ARM	Added Remarks	02/10/21 00:31:15	Sent to: Linked Events	HYLTVL
ARM	Added Remarks	02/10/21 00:31:27	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:33:14	Notes sent from FIRE event #210410004	CONABL
TWE	DUBLIN TWITTER MS	02/10/21 00:37:05		HYLTVL
ARM	Added Remarks	02/10/21 00:37:05		HYLTVL
ARM	Added Remarks	02/10/21 00:37:05	Sent to: Linked Events	HYLTVL
RSW	Reset Watchdog Timer	02/10/21 00:37:31	Units: 171,189 >>> 15Min.	HYLTVL
ARM	Added Remarks	02/10/21 00:43:18	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:45:10	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:46:31	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:48:32		HYLTVL
ARM	Added Remarks	02/10/21 00:48:32	Sent to: Linked Events	HYLTVL
ARM	Added Remarks	02/10/21 00:54:16	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 00:55:10	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 01:02:09	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 01:02:12	Notes sent from FIRE event #210410004	CONABL
VEVT	Viewed Event	02/10/21 01:02:16	User First Viewed Event CAD	CONABL
SP	Spawned	02/10/21 01:02:19	Spawned LAW event #210410018, callref #912	CONABL

ARM	Added Remarks	02/10/21 01:04:15	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 01:04:24	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 01:14:18	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 01:14:40	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 01:15:58	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 01:16:44	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 01:17:02	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 01:18:38	Notes sent from FIRE event #210410007	CONABL
ARM	Added Remarks	02/10/21 01:24:59		HYLTVL
ARM	Added Remarks	02/10/21 01:24:59	Sent to: Linked Events	HYLTVL
ARM	Added Remarks	02/10/21 01:31:01	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 02:04:47	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 02:15:08	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 02:16:41		HYLTVL
ARM	Added Remarks	02/10/21 02:16:41	Sent to: Linked Events	HYLTVL
ARM	Added Remarks	02/10/21 02:18:04	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 02:18:18	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 02:19:27	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 02:23:48	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 02:25:35	Notes sent from FIRE event #210410006	CONABL
ARM	Added Remarks	02/10/21 02:26:12	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 02:28:44	Notes sent from FIRE event #210410004	CONABL
ARM	Added Remarks	02/10/21 02:40:34	Notes sent from FIRE event #210410004	GERTBL
ARM	Added Remarks	02/10/21 02:44:00		HYLTVL
ARM	Added Remarks	02/10/21 02:44:00	Sent to: Linked Events	HYLTVL
ARM	Added Remarks	02/10/21 03:45:48	Notes sent from FIRE event #210410004	GERTBL
ARM	Added Remarks	02/10/21 03:45:54	Notes sent from FIRE event #210410004	GERTBL
ARM	Added Remarks	02/10/21 03:46:10	Notes sent from FIRE event #210410004	GERTBL
ARM	Added Remarks	02/10/21 05:49:07		HYLTVL
ARM	Added Remarks	02/10/21 05:49:07	Sent to: Linked Events	HYLTVL
VEVT	Viewed Event	02/10/21 06:21:59	User First Viewed Event CAD	GERTBL
RSW	Reset Watchdog Timer	02/10/21 06:31:50	Units: 168 >>> 999Min.	KARNBP
VEVT	Viewed Event	02/10/21 06:39:20	User First Viewed Event CAD	KARNBP
ENT	Entered RelNmOlnState	02/10/21 06:39:35	[ID: 746453] OH	KARNBP
ENT	Entered RelNmOln	02/10/21 06:39:35	[ID: 746453]	KARNBP
DLQ	Driver License Query	02/10/21 06:39:37	OLN [REDACTED] State: Name: <UNKNOWN#1>	KARNBP
CHG	Changed RelNmOln	02/10/21 06:39:48	[ID: 746453]	KARNBP
DLQ	Driver License Query	02/10/21 06:39:50	OLN: [REDACTED] ; State: Name: <UNKNOWN#1>	KARNBP
ENT	Entered RelNm Type	02/10/21 06:40:10	[ID: 746453] EMPL	KARNBP

CHG Changed RelLastName 02/10/21 06:40:13 [ID: 7464531 <UNKNOWN#1> --> SUTTLE M KARNBP
 ENT Entered RelFirstName 02/10/21 06:40:14 [ID: 7464531 SEAN M KARNBP
 ENT Entered RelMiddleName 02/10/21 06:40:14 [ID: 7464531 P M KARNBP
 VEVT Viewed Event 02/10/21 06:47:10 User First Viewed Event CAD ROSEGA
 RSW Reset Watchdog Timer 02/10/21 06:48:09 Units: 171 >>> 999Min. KARNBP
 VEVT Viewed Event 02/10/21 06:51:17 User First Viewed Event CAD GOLDBA
 RSW Reset Watchdog Timer 02/10/21 06:54:33 Units: 171 >>> 999Min. KARNBP
 VEVT Viewed Event 02/10/21 07:05:02 User First Viewed Event CAD SKIPSR
 ARM Added Remarks 02/10/21 07:14:27 Notes sent from FIRE event #210410004 GOLDBA
 ENT Entered RelNmOlnState 02/10/21 07:32:14 [ID: 7464631 OH M KARNBP
 ENT Entered RelNmOln 02/10/21 07:32:15 [ID: 7464631 State: Name: <UNKNOWN#1>, M KARNBP
 DLQ Driver License Query 02/10/21 07:32:16 OLN: State: Name: <UNKNOWN#1>, M KARNBP
 ENT Entered RelNmType 02/10/21 07:32:33 [ID: 7464631 OWNR M KARNBP
 CHG Changed RelLastName 02/10/21 07:32:35 [ID: 7464631 <UNKNOWN#1> --> HAMILTON M KARNBP
 ENT Entered RelFirstName 02/10/21 07:32:37 [ID: 7464631 SCOTT M KARNBP
 RSW Reset Watchdog Timer 02/10/21 08:02:15 Units: 151 >>> 999Min. M KARNBP
 ARM Added Remarks 02/10/21 08:26:49 Notes sent from FIRE event #210410004 GOLDBA
 RSW Reset Watchdog Timer 02/10/21 08:44:09 Units: 157 >>> 999Min. KARNBP
 RSW Reset Watchdog Timer 02/10/21 09:14:26 Units: 157 >>> 999Min. KARNBP
 ARM Added Remarks 02/10/21 09:25:23 Notes sent from FIRE event #210410004 GOLDBA
 ARM Added Remarks 02/10/21 09:26:38 Notes sent from FIRE event #210410004 GOLDBA
 ARM Added Remarks 02/10/21 09:43:37 Notes sent from FIRE event #210410004 GOLDBA
 RSW Reset Watchdog Timer 02/10/21 09:53:15 Units: 116 >>> 899Min. KARNBP

Related Names

Last, First, MI Suffix	Type	Race	Sex	HT	WT	Eyes	DOB	Age	Home / Mobile Ph	Work Ph
Denay	CALL									

Address:

Oln:

Notes:

Suttle, Sean P

Address:

Oln:

Notes:

Hamilton, Scott

Address:

Oln:

Oln St. OH

Notes:

Event Notes Addendum

Notes

[FIRE] PREV CLEAR FROM THE BUILDING [02/10/21 09:43:37 GOLDBA]
[FIRE] E95 NOZZLE MAKING ENTRY [02/10/21 09:26:38 GOLDBA]
[FIRE] P92 MAKING CONTACT AT 5241 LOCUST HILL LN [02/10/21 09:25:23 GOLDBA]
[FIRE] P94 REQ DPD TO BRING DRONE OUT TO FIRE SCENE [02/10/21 08:26:49 GOLDBA]
[FIRE] BN91 REQ E95 TO HIT SOME HOT SPOTS [02/10/21 07:14:27 GOLDBA]
{102} REPLACING 171 [02/10/21 05:49:07 HYLTVL]
[FIRE] OS IS E95, Q93 CREW, AND E83 [02/10/21 03:46:10 GERTBL]
[FIRE] LT REDMAN IS TAKING COMMAND [02/10/21 03:45:54 GERTBL]
[FIRE] {Q93} WILL BE ON E95 [02/10/21 03:45:48 GERTBL]
{189} CONTRACTOR IS 41 [02/10/21 02:44:00 HYLTVL]
[FIRE] E95 MAKING WAY INSIDE [02/10/21 02:40:34 GERTBL]
[FIRE] BROKEN HYDRANT IS A COLS HYDRANT [02/10/21 02:28:44 CONABL]
[FIRE] UDTS: PERSONNEL ACCOUNTABILITY [02/10/21 02:26:12 CONABL]
[FIRE] {L84} UNABLE TO CLAMP OFF HOSE FOR BROKEN HYDRANT [02/10/21 02:25:35 CONABL]
[FIRE] COLS WATER NOTIFIED [02/10/21 02:23:48 CONABL]
[FIRE] {P94} CONTRACTOR FOR SITE IS ER [02/10/21 02:19:27 CONABL]
[FIRE] STREETS ARE OUT / WILL CHECK TO SEE IF THEY CAN SHUT IT OFF [02/10/21 02:18:18 CONABL]
[FIRE] {BN91} WATER CO FOR BROKEN STEM ON HYDRANT [02/10/21 02:18:04 CONABL]
{189} MEDIA IS 41 [02/10/21 02:16:41 HYLTVL]
[FIRE] 10MIN ELAPS [02/10/21 02:15:08 CONABL]
[FIRE] {BN91} CREWS GOING INSIDE / 10 MIN CHECKS STARTING FROM NOW [02/10/21 02:04:47 CONABL]
[FIRE] {BN91} ALL CO'S SHUT DOWN WATER OPS [02/10/21 01:31:01 CONABL]
{189} STREETS IS 41 [02/10/21 01:24:59 HYLTVL]
[FIRE] {SU19} TRAPPED AT SCENE AND WILL BE STANDING BY [02/10/21 01:18:38 CONABL]
[FIRE] BOX15 SET UP BEHIND ER91 [02/10/21 01:17:02 CONABL]
[FIRE] {BN91} CANX ISU19 / KEEP BOX15 [02/10/21 01:16:44 CONABL]
[FIRE] {BN91} SC TU ALL CO'S [02/10/21 01:15:58 CONABL]
[FIRE] {BN91} 20 MINS CHECKS GOING FORWARD [02/10/21 01:14:40 CONABL]
[FIRE] 50 MINS ELAPS DEFENSIVE MODE [02/10/21 01:14:18 CONABL]
[FIRE] {BN91} CHECKS OK [02/10/21 01:04:24 CONABL]
[FIRE] UDTS: PERSONNEL ACCOUNTABILITY [02/10/21 01:04:15 CONABL]
[FIRE] STREETS NOTIFIED [02/10/21 01:02:12 CONABL]
[FIRE] {BN91} NEED STREETS FOR SALT / WON'T BE ABLE TO GET A TRUCK BACK THERE [02/10/21 01:02:09 CONABL]
[FIRE] {BN91} STRUCTURE UNDER CONSTR / NO AC ON PRIM OR 2ND YET [02/10/21 00:55:10 CONABL]
[FIRE] 30 MIN ELAPSE [02/10/21 00:54:16 CONABL]
{189} COLUMBIA GAS ON SCENE [02/10/21 00:48:32 HYLTVL]

[FIRE] {P94} 34MIN ETA [02/10/21 00:46:31 CONABL]
 [FIRE] UDTS: PERSONNEL ACCOUNTABILITY [02/10/21 00:45:10 CONABL]
 [FIRE] ELEC CO ON SCENE [02/10/21 00:43:18 CONABL]
 UDTS: DUBLIN TWITTER MSG SENT [02/10/21 00:37:05 HYLTVL]
 [FIRE] E92 SUPPLY L91 [02/10/21 00:33:14 CONABL]
 [FIRE] {ER91} 250 LINE [02/10/21 00:31:27 CONABL]
 {189} AT LIMESTONE [02/10/21 00:31:15 HYLTVL]
 {171} DUBLIN SHUT DOWN AT ZETTLERS [02/10/21 00:30:55 HYLTVL]
 [FIRE] GAS SHUT OFF [02/10/21 00:30:34 CONABL]
 {189} DUBLIN SHUT DOWN [02/10/21 00:30:31 HYLTVL]
 [FIRE] UDTS: WATER ON THE FIRE [02/10/21 00:30:03 CONABL]
 [FIRE] WATER ON STRUCTURE [02/10/21 00:29:54 CONABL]
 [FIRE] WORKING PAGE SENT [02/10/21 00:28:43 JOHNUJ]
 [FIRE] {BN91} DEFENSIVE [02/10/21 00:27:31 CONABL]
 {189} WILL BE SHUTTING DUBLIN ROAD DOWN FOR FIRE DEPT [02/10/21 00:26:31 HYLTVL]
 [FIRE] PER P94 BUILDING UNDER CONSTRUCTION - SPRINKLER SYSTEM HAS BEEN ADDED - THERE ARE AREAS THAT ARE DANGEROUS IF THEY GO IN - WATCH THE SECOND FLOOR AND THE BASEMENT [02/10/21 00:26:01 CASEAM]
 [FIRE] {E92} GETTING WATER [02/10/21 00:25:54 CONABL]
 [FIRE] 7MINS ELAPSED FROM TIME OF CALL [02/10/21 00:24:16 CONABL]
 [FIRE] HYDRANT DUBLIN RD [02/10/21 00:23:59 CONABL]
 [FIRE] {BN91} HAVE COMM [02/10/21 00:23:33 CONABL]
 [FIRE] LT ERCKSON LOCUST HILL COMM TAC LINE [02/10/21 00:23:14 CONABL]
 [FIRE] {E95} OS HEAVY FIRE SHOWING FULLY INVOLVED 2ND FL UNDER CONSTR [02/10/21 00:23:02 CONABL]
 [FIRE] CALLER KIMBERLY WALLMAN ([REDACTED]) 1, FLAMES OUT THE TOP [02/10/21 00:22:14 HUNTLD]
 [FIRE] AEP WILL CALL WITH ETA [02/10/21 00:21:27 HUNTLD]
 UDTS: GAS COMPANY NOTIFIED [02/10/21 00:21:18 HYLTVL]
 [FIRE] UDTS: ELECTRIC COMPANY NOTIFIED [02/10/21 00:20:46 HUNTLD]
 [FIRE] CFD ADV [02/10/21 00:20:42 CASEAM]
 ANOTHER CALL CHAD COLLINS .. PASSERBY [REDACTED] [02/10/21 00:20:23 HYLTVL]
 [FIRE] WORK ER91[ENGINE], M92[MEDIC], ISU19[AIR], BN80[BATT] [02/10/21 00:19:17 CONABL]
 Event spawned from FIRE RESIDENTIAL. [02/10/2021 00:17:37 HYLTVL]
 Radio Channel: NWFG1 [02/10/21 00:17:01 CONABL]
 house fire - top of house on fire [02/10/21 00:16:48 CONABL]

Employee Info

Unit	Empl ID	Name
102	1781	RICCA, PAUL J
116	1224	KRUMM, PATRICK STEVE
116	1224	KRUMM, PATRICK STEVE
151	109	BEAM, DANIEL M
157	235	BROWN, SCOTT A
168	4116	RAHDE, MATTHEW R

Event ID: 0210-410-005

Call Ref #: 899

28-FIRE RUN at 5281 LOCUST HILL LN

171

4398

BOULWARE, ERIC K

189

4208

HYSELL, NATHAN MARK

COMMUNICATIONS

Event Report

Event ID: 0210-410-018 Call Ref #: 912 Date/Time Received: 02/10/21 01:02:19

Rpt #: Prime SU Unit:
Call Source: W911

Services Involved

LAW	FIRE		
-----	------	--	--

Location: 5281 LOCUST HILL LN

X-ST: DUBLIN RD Jur: CAD Service: LAW Agency: DUBL

St/Beat: D1 District: RA:

Business: Phone: GP: D101

Nature: 28-FIRE RUN Alarm Lvl: 1 Priority: 5 Medical Priority:

Reclassified Nature:

Caller: DENAY Alarm:
Addr: Phone: Alarm Type:

Vehicle #: St: Report Only: No Race: Sex: Age:

Call Taker: CONABL Console: DISPCON5

Geo-Verified Addr.: Yes Nature Summary Code: PASS Disposition: M Close Comments:

Notes:

See Event Notes Addendum at end of this report

Times

Call Received: 02/10/21 01:02:19	Time From Call Received	
Call Routed: 02/10/21 01:02:19		Unit Reaction: (1st Dispatch to 1st Arrive)
Call Take Finished: 02/10/21 01:02:19		En-Route: (1st Dispatch to 1st En-Route)
1st Dispatch: 02/10/21 01:02:19	(Time Held)	On-Scene: (1st Arrive to Last Clear)
1st En-Route: 02/10/21 01:02:19		
1st Arrive:		(Reaction Time)
Last Clear: 02/10/21 13:47:54	012:45:35	

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
SU		DXY	DispatchXY	02/10/21 01:02:19	1793861.00,764311.88		CONABL
SU		D	Dispatched	02/10/21 01:02:19			CONABL
SU		E	En-Route	02/10/21 01:02:19			CONABL
SU		C	Cleared	02/10/21 13:47:54	M	M	BURKCS

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TS	Time Spawned	02/10/21 01:02:19	Initial call received at 02/10/2021 00:17:37		CONABL
		ARM	Added Remarks	02/10/21 01:04:15	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 01:04:24	Notes sent from FIRE event #210410004		CONABL
		VEVT	Viewed Event	02/10/21 01:06:00	User First Viewed Event CAD		JOHNJL
		ARM	Added Remarks	02/10/21 01:14:18	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 01:14:40	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 01:15:58	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 01:16:44	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 01:17:02	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 01:18:38	Notes sent from FIRE event #210410007		CONABL
		ARM	Added Remarks	02/10/21 01:24:59	Notes sent from LAW event #210410005		HYLTVL
		ARM	Added Remarks	02/10/21 01:31:01	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 02:04:47	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 02:15:08	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 02:16:41	Notes sent from LAW event #210410005		HYLTVL
		ARM	Added Remarks	02/10/21 02:18:04	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 02:18:18	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 02:19:27	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 02:23:48	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 02:25:35	Notes sent from FIRE event #210410006		CONABL
		ARM	Added Remarks	02/10/21 02:26:12	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 02:28:44	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 02:40:35	Notes sent from FIRE event #210410004		CONABL
		ARM	Added Remarks	02/10/21 02:44:00	Notes sent from LAW event #210410005		GERTBL
		ARM	Added Remarks	02/10/21 03:45:48	Notes sent from FIRE event #210410004		HYLTVL
		ARM	Added Remarks	02/10/21 03:45:54	Notes sent from FIRE event #210410004		GERTBL
		ARM	Added Remarks	02/10/21 03:46:10	Notes sent from FIRE event #210410004		GERTBL
		ARM	Added Remarks	02/10/21 05:49:07	Notes sent from LAW event #210410005		HYLTVL

VEVT	Viewed Event	02/10/21 07:12:33	User First Viewed Event CAD	ROSEGA
RSW	Reset Watchdog Timer	02/10/21 07:12:39	Units: SU >>> 99Min.	ROSEGA
ARM	Added Remarks	02/10/21 07:14:27	Notes sent from FIRE event #210410004	GOLDBA
ARM	Added Remarks	02/10/21 08:26:49	Notes sent from FIRE event #210410004	GOLDBA
VEVT	Viewed Event	02/10/21 08:51:38	User First Viewed Event CAD	GREAWM
ARM	Added Remarks	02/10/21 09:25:23	Notes sent from FIRE event #210410004	GOLDBA
ARM	Added Remarks	02/10/21 09:26:38	Notes sent from FIRE event #210410004	GOLDBA
VEVT	Viewed Event	02/10/21 09:40:20	User First Viewed Event CAD	BURKCS
ARM	Added Remarks	02/10/21 09:43:37	Notes sent from FIRE event #210410004	GOLDBA
VEVT	Viewed Event	02/10/21 09:47:15	User First Viewed Event CAD	SKIPSR
ARM	Added Remarks	02/10/21 11:20:59	Notes sent from FIRE event #210410004	ROSEGA
ARM	Added Remarks	02/10/21 11:22:20	Notes sent from FIRE event #210410004	GOLDBA
ARM	Added Remarks	02/10/21 11:38:48	Notes sent from FIRE event #210410004	GOLDBA
ARM	Added Remarks	02/10/21 12:28:43	Notes sent from FIRE event #210410004	ROSEGA
ARM	Added Remarks	02/10/21 12:30:52	Notes sent from FIRE event #210410004	ROSEGA
ARM	Added Remarks	02/10/21 12:39:08	Notes sent from FIRE event #210410004	SEYMCC
ARM	Added Remarks	02/10/21 12:51:36	Notes sent from FIRE event #210410004	ROSEGA
ARM	Added Remarks	02/10/21 13:01:11	Notes sent from LAW event #210410309	ROSEGA
ARM	Added Remarks	02/10/21 13:07:16	Notes sent from FIRE event #210410004	ROSEGA
ARM	Added Remarks	02/10/21 13:13:36	Notes sent from FIRE event #210410004	ROSEGA
ARM	Added Remarks	02/10/21 13:39:22	Notes sent from FIRE event #210410004	ROSEGA

Related Names

Last, First, MI Suffix	Type	Race	Sex	HT	WT	Eyes	DOB	Age	Home / Mobile Ph	Work Ph
Denay	CALL							0	(614) 425-0711	

Address:

OIn:

Notes:

OIn St:

Event Notes Addendum

Notes [FIRE] {P92} COLUMBUS K9 4 CLEARING THE SCENE [02/10/21 13:39:22 ROSEGA]
 [FIRE] {E95} DUBLIN RD BACK OPEN [02/10/21 13:13:36 ROSEGA]
 [FIRE] {E95} DUBLIN ROAD IS SHUT DOWN TEMPORARILY [02/10/21 13:07:16 ROSEGA]
 [LAW] needs PD to temporarily shut down Dublin Rd again*** [02/10/21 13:01:11 ROSEGA]
 [FIRE] {P92} K9 4 FROM CFD ON SCENE [02/10/21 12:51:36 ROSEGA]
 [FIRE] CFD K9 4 en route eta 20 min [02/10/21 12:39:08 SEYMCC]
 [FIRE] they will call us back after they determine one is available** [02/10/21 12:30:52 ROSEGA]

[FIRE] {P92} SEE IF WE CAN GET AN ACCELERATE DOG FROM CFD [02/10/21 12:28:43 ROSEGA]
 [FIRE] E95 PERSONAL OUT OF STRUCTURE [02/10/21 11:38:48 GOLDBA]
 [FIRE] REMAINING COMPANY'S NW FG2 [02/10/21 11:22:20 GOLDBA]
 [FIRE] GOING TO FIRE GROUND 2***** [02/10/21 11:20:59 ROSEGA]
 [FIRE] PREV CLEAR FROM THE BUILDING [02/10/21 09:43:37 GOLDBA]
 [FIRE] E95 NOZZLE MAKING ENTRY [02/10/21 09:26:38 GOLDBA]
 [FIRE] P92 MAKING CONTACT AT 5241 LOCUST HILL LN [02/10/21 09:25:23 GOLDBA]
 [FIRE] P94 REQ DPD TO BRING DRONE OUT TO FIRE SCENE [02/10/21 08:26:49 GOLDBA]
 [FIRE] BN91 REQ E95 TO HIT SOME HOT SPOTS [02/10/21 07:14:27 GOLDBA]
 [LAW] {102} REPLACING 171 [02/10/21 05:49:07 HYLTVL]
 [FIRE] OS IS E95, Q93 CREW, AND E83 [02/10/21 03:46:10 GERTBL]
 [FIRE] LT REDMAN IS TAKING COMMAND [02/10/21 03:45:54 GERTBL]
 [FIRE] {Q93} WILL BE ON E95 [02/10/21 03:45:48 GERTBL]
 [LAW] {189} CONTRACTOR IS 41 [02/10/21 02:44:00 HYLTVL]
 [FIRE] E95 MAKING WAY INSIDE [02/10/21 02:40:35 GERTBL]
 [FIRE] BROKEN HYDRANT IS A COLS HYDRANT [02/10/21 02:28:44 CONABL]
 [FIRE] UDTS: PERSONNEL ACCOUNTABILITY [02/10/21 02:26:12 CONABL]
 [FIRE] {L81} UNABLE TO CLAMP OFF HOSE FOR BROKEN HYDRANT [02/10/21 02:25:35 CONABL]
 [FIRE] COLS WATER NOTIFIED [02/10/21 02:23:48 CONABL]
 [FIRE] {P94} CONTRACTOR FOR SITE IS E/R [02/10/21 02:19:27 CONABL]
 [FIRE] STREETS ARE OUT / WILL CHECK TO SEE IF THEY CAN SHUT IT OFF [02/10/21 02:18:18 CONABL]
 [FIRE] {BN91} WATER CO FOR BROKEN STEM ON HYDRANT [02/10/21 02:18:04 CONABL]
 [LAW] {189} MEDIA IS 41 [02/10/21 02:16:41 HYLTVL]
 [FIRE] 10MIN ELAPS [02/10/21 02:15:08 CONABL]
 [FIRE] {BN91} CREWS GOING INSIDE / 10 MIN CHECKS STARTING FROM NOW [02/10/21 02:04:47 CONABL]
 [FIRE] {BN91} ALL CO'S SHUT DOWN WATER OPS [02/10/21 01:31:01 CONABL]
 [LAW] {189} STREETS IS 41 [02/10/21 01:24:59 HYLTVL]
 [FIRE] {ISU19} TRAPPED AT SCENE AND WILL BE STANDING BY [02/10/21 01:18:38 CONABL]
 [FIRE] BOX15 SET UP BEHIND ER91 [02/10/21 01:17:02 CONABL]
 [FIRE] {BN91} CANX ISU19 / KEEP BOX15 [02/10/21 01:16:44 CONABL]
 [FIRE] {BN91} SC TU ALL CO'S [02/10/21 01:15:58 CONABL]
 [FIRE] {BN91} 20 MINS CHECKS GOING FORWARD [02/10/21 01:14:40 CONABL]
 [FIRE] 50 MINS ELAPS DEFENSIVE MODE [02/10/21 01:14:18 CONABL]
 [FIRE] {BN91} CHECKS OK [02/10/21 01:04:24 CONABL]
 [FIRE] UDTS: PERSONNEL ACCOUNTABILITY [02/10/21 01:04:15 CONABL]
 [FIRE] STREETS NOTIFIED [02/10/21 01:02:12 CONABL]
 [FIRE] {BN91} NEED STREETS FOR SALT / WON'T BE ABLE TO GET A TRUCK BACK THERE [02/10/21 01:02:09 CONABL]
 [FIRE] {BN91} STRUCTURE UNDER CONSTR / NO AC ON PRIM OR 2ND YET [02/10/21 00:55:10 CONABL]
 [FIRE] 30 MIN ELAPSE [02/10/21 00:54:16 CONABL]
 {189} COLUMBIA GAS ON SCENE [02/10/21 00:48:32 HYLTVL]
 [FIRE] {P94} 34MIN ETA [02/10/21 00:46:31 CONABL]
 [FIRE] UDTS: PERSONNEL ACCOUNTABILITY [02/10/21 00:45:10 CONABL]
 [FIRE] ELEC CO ON SCENE [02/10/21 00:43:18 CONABL]
 UDTS: DUBLIN TWITTER MSG SENT [02/10/21 00:37:05 HYLTVL]

[FIRE] E92 SUPPLY L91 [02/10/21 00:33:14 CONABL]
[FIRE] {ER91} 250 LINE [02/10/21 00:31:27 CONABL]
{189} AT LIMESTONE [02/10/21 00:31:15 HYLTVL]
{171} DUBLIN SHUT DOWN AT ZETTLERS [02/10/21 00:30:55 HYLTVL]
[FIRE] GAS SHUT OFF [02/10/21 00:30:34 CONABL]
{189} DUBLIN SHUT DOWN [02/10/21 00:30:31 HYLTVL]
[FIRE] UDTS: WATER ON THE FIRE [02/10/21 00:30:03 CONABL]
[FIRE] WATER ON STRUCTURE [02/10/21 00:29:54 CONABL]
[FIRE] WORKING PAGE SENT [02/10/21 00:28:43 JOHNUL]
[FIRE] {BN91} DEFENSIVE [02/10/21 00:27:31 CONABL]
{189} WILL BE SHUTTING DUBLIN ROAD DOWN FOR FIRE DEPT [02/10/21 00:26:31 HYLTVL]
[FIRE] PER P94 BUILDING UNDER CONSTRUCTION - SPRINKLER SYSTEM HAS BEEN ADDED - THERE ARE AREAS THAT ARE DANGEROUS IF THEY GO IN - WATCH THE SECOND FLOOR AND THE BASEMENT [02/10/21 00:26:01 CASEAM]
[FIRE] {E92} GETTING WATER [02/10/21 00:25:54 CONABL]
[FIRE] 7MINS ELAPSED FROM TIME OF CALL [02/10/21 00:24:16 CONABL]
[FIRE] HYDRANT DUBLIN RD [02/10/21 00:23:59 CONABL]
[FIRE] {BN91} HAVE COMM [02/10/21 00:23:33 CONABL]
[FIRE] LT ERCKSON LOCUST HILL COMM TAC LINE [02/10/21 00:23:14 CONABL]
[FIRE] {E95} OS HEAVY FIRE SHOWING FULLY INVOLVED 2ND FL UNDER CONSTR [02/10/21 00:23:02 CONABL]
[FIRE] CALLER KIMBERLY WALLMAN [REDACTED], FLAMES OUT THE TOP [02/10/21 00:22:14 HUNTLD]
[FIRE] AEP WILL CALL WITH ETA [02/10/21 00:21:27 HUNTLD]
UDTS: GAS COMPANY NOTIFIED [02/10/21 00:21:18 HYLTVL]
[FIRE] UDTS: ELECTRIC COMPANY NOTIFIED [02/10/21 00:20:46 HUNTLD]
[FIRE] CFD ADV [02/10/21 00:20:42 CASEAM]
ANOTHER CALL CHAD COLLINS .. PASSERBY [REDACTED] [02/10/21 00:20:23 HYLTVL]
[FIRE] WORK ER91[ENGINE], M92[MEDIC], ISU19[AIR], BN80[BATT] [02/10/21 00:19:17 CONABL]
Event spawned from FIRE RESIDENTIAL. [02/10/2021 00:17:37 HYLTVL]
Radio Channel: NWF01 [02/10/21 00:17:01 CONABL]
house fire - top of house on fire [02/10/21 00:16:48 CONABL]

COMMUNICATIONS

Event Report

Event ID: 0210-410-309 Call Ref #: 225 Date/Time Received: 02/10/21 13:00:43

Rpt #: 21-000509 Prime 157 Services Involved
Call Source: W911 Unit: BROWN, SCOTTA

LAW	FIRE	
-----	------	--

Location: 5281 LOCUST HILL LN
X-ST: DUBLIN RD Jur: CAD Service: LAW Agency: DPD
Business: St/Beat: D1 District: RA: GP: D101
Phone: Medical Priority:

Nature: 28-FIRE RUN Alarm Lvl: 1 Priority: 5

Reclassified Nature:

Caller: DENAY Alarm:
Addr: 5241 LOCUST HILL LN Phone: [REDACTED] Alarm Type:

Vehicle #: St: Report Only: No Race: Sex: Age:

Call Taker: ROSEGA Console: DISPCON110

Geo-Verified Addr.: Yes Nature Summary Code: PASS Disposition: M Close Comments:

Notes:

See Event Notes Addendum at end of this report

Times

	Time From Call Received	Times
Call Received:	02/10/21 13:00:43	
Call Routed:	02/10/21 13:00:43	
Call Take Finished:	02/10/21 13:00:43	
1st Dispatch:	02/10/21 13:02:35	Unit Reaction: 000:08:49 (1st Dispatch to 1st Arrive)
1st En-Route:	02/10/21 13:02:50	En-Route: 000:00:15 (1st Dispatch to 1st En-Route)
1st Arrive:	02/10/21 13:11:24	On-Scene: 000:26:25 (1st Arrive to Last Clear)
Last Clear:	02/10/21 13:37:49	
		000:01:52 (Time Held)
		000:02:07
		000:10:41 (Reaction Time)
		000:37:06

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
165	1466	DXY	DispatchXY	02/10/21 13:02:35	1782821.71,763041.44		KARNBP
165	1466	D	Dispatched	02/10/21 13:02:35	Stat/Beat: D4		KARNBP
165	1466	E	En-Route	02/10/21 13:02:50			KARNBP
116	1224	DXY	DispatchXY	02/10/21 13:02:55	1788934.75,765586.19		KARNBP
116	1224	D	Dispatched	02/10/21 13:02:55	Stat/Beat: D3		KARNBP
116	1224	E	En-Route	02/10/21 13:03:00			KARNBP
116	1224	AET	Auto Enroute Timestam	02/10/21 13:03:31	Current status is:E. Offset of 0 seconds.		KRUMSS
165	1466	AET	Auto Enroute Timestam	02/10/21 13:04:42	Current status is:E. Offset of 1 seconds.		MILLJR
116	1224	A	Arrived	02/10/21 13:11:24	Auto-arriving with offset of 0 seconds.		KRUMSS
165	1466	C	Cleared	02/10/21 13:12:09	X	X	KARNBP
116	1224	C	Cleared	02/10/21 13:13:50	M	M	KARNBP
157	235	DXY	DispatchXY	02/10/21 13:25:10	1789508.61,766471.09		KARNBP
157	235	D	Dispatched	02/10/21 13:25:10	Stat/Beat: DCIT		KARNBP
157	235	E	En-Route	02/10/21 13:25:31	Auto-enrouting with offset of 4 seconds.		BROWSA
157	235	A	Arrived	02/10/21 13:33:27	Auto-arriving with offset of 0 seconds.		BROWSA
157	235	C	Cleared	02/10/21 13:37:49		M	BROWSA

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TS	Time Spawned	02/10/21 13:00:43	Initial call received at 02/10/2021 00:16:14		ROSEGA
		PAGE	Automatic Nature Page	02/10/21 13:00:46	Paged ZGDPD1		PAGESRV
		VEVT	Viewed Event	02/10/21 13:00:47	User First Viewed Event CAD		ROSEGA
		ARM	Added Remarks	02/10/21 13:01:11			ROSEGA
		ARM	Added Remarks	02/10/21 13:01:11	Sent to: Linked Events		ROSEGA
		VEVT	Viewed Event	02/10/21 13:02:20	User First Viewed Event CAD		KARNBP
		ARM	Added Remarks	02/10/21 13:07:16	Notes sent from FIRE event #210410004		ROSEGA
		ARM	Added Remarks	02/10/21 13:13:36	Notes sent from FIRE event #210410004		ROSEGA
		ROPN	Re-Opened Event	02/10/21 13:25:04	157		KARNBP
		RPT	Requested Report#	02/24/21 16:31:40	DPD Report # 21000509		FLESAM

Related Names

Last, First, MI Suffix	Type	Race	Sex	HT	WT	Eyes	DOB	Age	Home / Mobile Ph	Work Ph
Denay	CALL							0	(614) 425-0711	

Address: 5241 Locust Hill Ln, Dublin, OH 43017

Oln:

Oln St:

Notes:

Event Notes Addendum

Notes This is a reopened incident. [02/10/2021 13:25:04 KARNBP]
 [FIRE] {E95} DUBLIN RD BACK OPEN [02/10/21 13:13:36 ROSEGA]
 [FIRE] {E95} DUBLIN ROAD IS SHUT DOWN TEMPORARILY [02/10/21 13:07:16 ROSEGA]
 needs PD to temporarily shut down Dublin Rd again*** [02/10/21 13:01:11 ROSEGA]
 Event spawned from WORKING FIRE RESIDENTIAL. [02/10/2021 13:00:43 ROSEGA]
 {P92} K9 4 FROM CFD ON SCENE [02/10/21 12:51:36 ROSEGA]
 CFD K9 4 en route eta 20 min [02/10/21 12:39:08 SEYMCC]
 they will call us back after they determine one is available** [02/10/21 12:30:52 ROSEGA]
 {P92} SEE IF WE CAN GET AN ACCELERATE DOG FROM CFD [02/10/21 12:28:43 ROSEGA]
 E95 PERSONAL OUT OF STRUCTURE [02/10/21 11:38:48 GOLDBA]
 REMAINING COMPANYS NW FG2 [02/10/21 11:22:20 GOLDBA]
 GOING TO FIRE GROUND 2***** [02/10/21 11:20:59 ROSEGA]
 PREV CLEAR FROM THE BUILDING [02/10/21 09:43:37 GOLDBA]
 E95 NOZZLE MAKING ENTRY [02/10/21 09:26:38 GOLDBA]
 P92 MAKING CONTACT AT 5241 LOCUST HILL LN [02/10/21 09:25:23 GOLDBA]
 P94 REQ DPD TO BRING DRONE OUT TO FIRE SCENE [02/10/21 08:26:49 GOLDBA]
 BN91 REQ E95 TO HIT SOME HOT SPOTS [02/10/21 07:14:27 GOLDBA]
 [LAW] {102} REPLACING 171 [02/10/21 05:49:07 HYLTVL]
 OS IS E95, Q93 CREW, AND E83 [02/10/21 03:46:10 GERTBL]
 LT REDMAN IS TAKING COMMAND [02/10/21 03:45:54 GERTBL]
 {Q93} WILL BE ON E95 [02/10/21 03:45:48 GERTBL]
 [LAW] {189} CONTRACTOR IS 41 [02/10/21 02:44:00 HYLTVL]
 E95 MAKING WAY INSIDE [02/10/21 02:40:34 GERTBL]
 BROKEN HYDRANT IS A COLS HYDRANT [02/10/21 02:28:44 CONABL]
 UDTs: PERSONNEL ACCOUNTABILITY [02/10/21 02:26:12 CONABL]
 [FIRE] {L81} UNABLE TO CLAMP OFF HOSE FOR BROKEN HYDRANT [02/10/21 02:25:35 CONABL]
 COLS WATER NOTIFIED [02/10/21 02:23:48 CONABL]
 {P94} CONTRACTOR FOR SITE IS E/R [02/10/21 02:19:27 CONABL]
 STREETS ARE OUT / WILL CHECK TO SEE IF THEY CAN SHUT IT OFF [02/10/21 02:18:18 CONABL]
 {BN91} WATER CO FOR BROKEN STEM ON HYDRANT [02/10/21 02:18:03 CONABL]
 [LAW] {189} MEDIA IS 41 [02/10/21 02:16:41 HYLTVL]
 10MIN ELAPS [02/10/21 02:15:08 CONABL]
 {BN91} CREWS GOING INSIDE / 10 MIN CHECKS STARTING FROM NOW [02/10/21 02:04:47 CONABL]
 {BN91} ALL CO'S SHUT DOWN WATER OPS [02/10/21 01:31:01 CONABL]
 [LAW] {189} STREETS IS 41 [02/10/21 01:24:59 HYLTVL]
 [FIRE] {ISU19} TRAPPED AT SCENE AND WILL BE STANDING BY [02/10/21 01:18:38 CONABL]
 BOX15 SET UP BEHIND ER91 [02/10/21 01:17:02 CONABL]

{BN91} CANX ISU19 / KEEP BOX15 [02/10/21 01:16:44 CONABL]
{BN91} SC TU ALL CO'S [02/10/21 01:15:58 CONABL]
{BN91} 20 MINS CHECKS GOING FORWARD [02/10/21 01:14:40 CONABL]
50 MINS ELAPS DEFENSIVE MODE [02/10/21 01:14:18 CONABL]
{BN91} CHECKS OK [02/10/21 01:04:24 CONABL]
UDTS: PERSONNEL ACCOUNTABILITY [02/10/21 01:04:15 CONABL]
STREETS NOTIFIED [02/10/21 01:02:12 CONABL]
{BN91} NEED STREETS FOR SALT / WON'T BE ABLE TO GET A TRUCK BACK THERE [02/10/21 01:02:09 CONABL]
{BN91} STRUCTURE UNDER CONSTR / NO AC ON PRIM OR 2ND YET [02/10/21 00:55:10 CONABL]
30 MIN ELAPSE [02/10/21 00:54:16 CONABL]
[LAW] {189} COLUMBIA GAS ON SCENE [02/10/21 00:48:32 HYLTVL]
{P94} 34MIN ETA [02/10/21 00:46:31 CONABL]
UDTS: PERSONNEL ACCOUNTABILITY [02/10/21 00:45:10 CONABL]
ELEC CO ON SCENE [02/10/21 00:43:18 CONABL]
[LAW] UDTS: DUBLIN TWITTER MSG SENT [02/10/21 00:37:05 HYLTVL]
E92 SUPPLY L91 [02/10/21 00:33:14 CONABL]
{ER91} 250 LINE [02/10/21 00:31:27 CONABL]
[LAW] {189} AT LIMESTONE [02/10/21 00:31:15 HYLTVL]
[LAW] {171} DUBLIN SHUT DOWN AT ZETTLERS [02/10/21 00:30:55 HYLTVL]
GAS SHUT OFF [02/10/21 00:30:34 CONABL]
[LAW] {189} DUBLIN SHUT DOWN [02/10/21 00:30:31 HYLTVL]
UDTS: WATER ON THE FIRE [02/10/21 00:30:03 CONABL]
WATER ON STRUCTURE [02/10/21 00:29:54 CONABL]
WORKING PAGE SENT [02/10/21 00:28:43 JOHNL]
{BN91} DEFENSIVE [02/10/21 00:27:31 CONABL]
[LAW] {189} WILL BE SHUTTING DUBLIN ROAD DOWN FOR FIRE DEPT [02/10/21 00:26:31 HYLTVL]
PER P94 BUILDING UNDER CONSTRUCTION - SPRINKLER SYSTEM HAS BEEN ADDED - THERE ARE AREAS THAT ARE DANGEROUS IF
THEY GO IN - WATCH THE SECOND FLOOR AND THE BASEMENT [02/10/21 00:26:01 CASEAM]
{E92} GETTING WATER [02/10/21 00:25:54 CONABL]
7MINS ELAPSED FROM TIME OF CALL [02/10/21 00:24:16 CONABL]
HYDRANT DUBLIN RD [02/10/21 00:23:59 CONABL]
{BN91} HAVE COMM [02/10/21 00:23:33 CONABL]
LT ERCKSON LOCUST HILL COMM TAG LINE [02/10/21 00:23:14 CONABL]
{E95} OS HEAVY FIRE SHOWING FULLY INVOLVED 2ND FL UNDER CONSTR [02/10/21 00:23:02 CONABL]
CALLER KIMBERLY WALLMAN [REDACTED] FLAMES OUT THE TOP [02/10/21 00:22:14 HUNTLD]
AEP WILL CALL WITH ETA [02/10/21 00:21:27 HUNTLD]
[LAW] UDTS: GAS COMPANY NOTIFIED [02/10/21 00:21:18 HYLTVL]
UDTS: ELECTRIC COMPANY NOTIFIED [02/10/21 00:20:46 HUNTLD]
CFD ADV [02/10/21 00:20:42 CASEAM]
[LAW] ANOTHER CALL CHAD COLLINS .. PASSERBY [REDACTED] [02/10/21 00:20:23 HYLTVL]
WORKER91[ENGINE], M92[MEDIC], ISU19[AIR], BN80[BATT] [02/10/21 00:19:17 CONABL]
Radio Channel: NWF01 [02/10/21 00:17:01 CONABL]
house fire - top of house on fire [02/10/21 00:16:48 CONABL]

Employee Info

Unit	Empl ID	Name
116	1224	KRUMM, PATRICK STEVE
157	235	BROWN, SCOTT A
165	1466	MILLER, JEREMY R

COMMUNICATIONS

Event Report

Event ID: 0210-430-304 Call Ref #: 437

Date/Time Received: 02/12/21 12:44:08

Rpt #: Prime 135

Call Source: PHONE

Unit: WHITTAKER, GWEN J

Services Involved

LAW

Location: 5281 LOCUST HILL LN

X-ST: DUBLIN RD

Jur: CAD Service: LAW Agency: DPD

St/Beat: D1 District: RA:

Business: MULTI-FAMILY RESIDENCE

Phone: GP: D101

Nature: 90-DISTURBANCE 2 UNITS Alarm Lvl: 1 Priority: 4

Medical Priority:

Reclassified Nature:

Caller: BN91

Addl:

Phone:

Alarm:

Alarm Type:

Vehicle #: FAK6631

St: OH

Report Only: No

Race:

Sex:

Age:

Call Taker: HUGHJM

Console: DISPCON5

Geo-Verified Addr.: Yes Nature Summary Code: PASS

Disposition: M

Close Comments:

Notes: EPX1940 ARRIVED, MET WITH OWNER, THEN LEFT. [02/12/21 13:59:03 Unit:135]
RL994864 [02/12/21 13:09:42 ROSEGA]
{109} LOG 7 AND 11 INTO THIS CALL AFTER LEADS COMES BACK UP [02/12/21 13:09:06 ROSEGA]
owner is in FAK6631. [02/12/21 12:54:56 Unit:135]
17 with fire prevention on scene. States the homeowners are on scene and acting strange.
Fire prevention requesting police presence. [02/12/21 12:45:58 HUGHJM]

Times

Event ID: 0210-430-304

Call Ref #: 437

90-DISTURBANCE 2 UNITS at 5281 LOCUST HILL LN

Time From Call Received

Call Received: 02/12/21 12:44:08
 Call Routed: 02/12/21 12:45:58 Unit Reaction: 000:04:11 (1st Dispatch to 1st Arrive)
 Call Take Finished: 02/12/21 12:45:58 En-Route: 000:00:03 (1st Dispatch to 1st En-Route)
 1st Dispatch: 02/12/21 12:48:08 On-Scene: 001:59:34 (1st Arrive to Last Clear)
 1st En-Route: 02/12/21 12:48:11
 1st Arrive: 02/12/21 12:52:19
 Last Clear: 02/12/21 14:51:53

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
135	2270	DXY	DispatchXY	02/12/21 12:48:08	1796322.12,759139.03		ROSEGA
135	2270	D	Dispatched	02/12/21 12:48:08	Stat/Beat: D1		ROSEGA
121	3311	DXY	DispatchXY	02/12/21 12:48:08	1784238.63,763534.72		ROSEGA
121	3311	D	Dispatched	02/12/21 12:48:08	Stat/Beat: D6		ROSEGA
121	3311	E	En-Route	02/12/21 12:48:11	Auto-enrouting with offset of 1 seconds.		POPSJS
135	2270	E	En-Route	02/12/21 12:48:13	Auto-enrouting with offset of 1 seconds.		WALSGJ
135	2270	A	Arrived	02/12/21 12:52:19	Auto-arriving with offset of 0 seconds.		WALSGJ
109	1006	DXY	DispatchXY	02/12/21 13:02:49	1796754.65,757461.44		HOSTTD
109	1006	D	Dispatched	02/12/21 13:02:49	Stat/Beat: DSUP		HOSTTD
109	1006	E	En-Route	02/12/21 13:02:49	Stat/Beat: DSUP		HOSTTD
109	1006	A	Arrived	02/12/21 13:02:49	Stat/Beat: DSUP		HOSTTD
109	1006	AAT	Auto Arrive Timestamp	02/12/21 13:02:55	Current status is:A. Offset of 0 seconds.		HOSTTD
121	3311	C	Cleared	02/12/21 13:03:44	X	X	ROSEGA
109	1006	C	Cleared	02/12/21 13:13:41		MB	HOSTTD
135	2270	C	Cleared	02/12/21 14:51:53	M	M	HUNGZL

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TR	Time Received	02/12/21 12:44:08	By: PHONE		HUGHJM
		DLS	Duplicate List	02/12/21 12:44:16	Potential Duplicate Events Listed (1		HUGHJM
		ENT	Entered Street	02/12/21 12:44:47	LOCUST HILL LN/DUBLIN RD		HUGHJM
		ENT	Entered Nature	02/12/21 12:44:53	90-DISTURBANCE 2 UNITS		HUGHJM
		ENT	Entered Remarks	02/12/21 12:45:58			HUGHJM
		FIN	Finished Call Taking	02/12/21 12:45:58			HUGHJM
		PAGE	Automatic Nature Page	02/12/21 12:45:59	Paged ZGDPD1		PAGESRV
		ENT	Entered CallerName Ca	02/12/21 12:46:03	BN91		HUGHJM

VEVT	Viewed Event	02/12/21 12:47:56	User First Viewed Event CAD	ROSEGA
RECO	Unit Rec Btn Click	02/12/21 12:48:02	1) Unit recommend for 90-DISTURBANCE 2 UNITS at	ROSEGA
...	Unit Rec Btn Click...	02/12/21 12:48:02	2) LOCUST HILL LN/DUBLIN RD (Caller: BN91)	ROSEGA
RECO	Unit Recommendation	02/12/21 12:48:08	Plan: DPDM Cat: 02 Lvl: 1	ROSEGA
RECO	Unit Recommendation	02/12/21 12:48:08	Recmnd:135 [PATI, 121 [PATI	ROSEGA
VEVT	Viewed Event	02/12/21 12:51:06	User First Viewed Event CAD	BURKCS
VEVT	Viewed Event	02/12/21 12:54:36	User First Viewed Event CAD	GALLTP
ARM	Added Remarks	02/12/21 12:54:56		Unit:135
ENT	Entered VehicleID	02/12/21 12:55:20	[ID: 261625] FAK6631	ROSEGA
ENT	Entered LicenseType	02/12/21 12:55:20	[ID: 261625] PC	ROSEGA
ENT	Entered VehicleState	02/12/21 12:55:20	[ID: 261625] OH	ROSEGA
VHQ	Vehicle Query	02/12/21 12:55:21	Tag:FAK6631 State: OH Type: PC	ROSEGA
NCIC	QRY:	02/12/21 12:55:21	1) UNIT:135 State=OH, TagState=OH, Tag=FAK6631,	ROSEGA
...	QRY:...	02/12/21 12:55:21	2) DefaultState=OH	ROSEGA
RSW	Reset Watchdog Timer	02/12/21 12:58:19	Units: 121 >>> 10Min.	ROSEGA
PAGE	Automatic Nature Page	02/12/21 13:06:32	Paged ZGDPD1	ROSEGA
CHG	Changed Street	02/12/21 13:06:32	LOCUST HILL LN/DUBLIN RD --> 5281 LOCUST HILL LN	PAGESRV
VPRM	Viewed Premise	02/12/21 13:06:37	Location Information	ROSEGA
VCHS	Viewed Call History	02/12/21 13:06:48	Location Information	ROSEGA
VCHS	Viewed Call History	02/12/21 13:06:50	Location Information	ROSEGA
RSW	Reset Watchdog Timer	02/12/21 13:08:17	Units: 135 >>> 15Min.	ROSEGA
ARM	Added Remarks	02/12/21 13:09:06		ROSEGA
ARM	Added Remarks	02/12/21 13:09:42		ROSEGA
ENT	Entered RelNmType	02/12/21 13:09:56	[ID: 747325] OTHR	ROSEGA
CHG	Changed RelLastName	02/12/21 13:09:58	[ID: 747325] <UNKNOWN#1> --> HAMILTON	ROSEGA
ENT	Entered RelFirstName	02/12/21 13:10:00	[ID: 747325] SCOTT	ROSEGA
ENT	Entered RelNmOlnState	02/12/21 13:10:07	[ID: 747325] OH	ROSEGA
ENT	Entered RelNmOln	02/12/21 13:10:07	[ID: 747325] OH	ROSEGA
VCHS	Viewed Call History	02/12/21 13:21:51	Location Information	ROSEGA
RSW	Reset Watchdog Timer	02/12/21 13:35:34	Units: 135 >>> 15Min.	ROSEGA
RSW	Reset Watchdog Timer	02/12/21 13:50:56	Units: 135 >>> 15Min.	ROSEGA
ARM	Added Remarks	02/12/21 13:59:03		Unit:135
RVEH	Related Vehicle	02/12/21 14:00:49	EPX1940 OH added as a related vehicle	ROSEGA
RSW	Reset Watchdog Timer	02/12/21 14:06:10	Units: 135 >>> 15Min.	ROSEGA
VEVT	Viewed Event	02/12/21 14:25:05	User First Viewed Event CAD	CAINJM
VEVT	Viewed Event	02/12/21 14:29:04	User First Viewed Event CAD	HUNGZL
VCHS	Viewed Call History	02/12/21 14:29:23	Location Information	HUNGZL

Related Names

Last, First, MI Suffix Type Race Sex HT WT Eyes DOB Age Home / Mobile Ph Work Ph
 Bn91 CALL 0

Address:

Oln St:

Notes:

Hamilton, Scott E

OTHER W M 600 190 BLU 08/24/61 59

Address: 21865 Shirk Rd, Marysville, OH 43040

Oln:

Oln St: OH

Notes:

Related Vehicles

Lic Tag	State	Type	Year	Make	Make Desc	Model	Color1	Color2	Vin
FAK6631	OH	PC	2006	HOND	HONDA		BRZ		1HGCM56836A084752
EPX1940	OH	PC	2002	DODG	DODGE		RED		2B4GP44R32R672621

Notes:

Notes:

Employee Info

Unit	Empl ID	Name
109	1006	HOSTERMAN, TIM D
121	3311	POPSON, JOSEPH S
135	2270	WHITTAKER, GWEN J

COMMUNICATIONS

Event Report

Event ID: 0210-560-348 Call Ref #: 958 Date/Time Received: 02/25/21 12:46:17

Rpt #: Prime Unit: Services Involved

Call Source: SELF LAW

Location: 5281 LOCUST HILL LN

X-ST: DUBLIN RD Jur: CAD Service: LAW Agency: DPD
Business: LODGE AT HAYDEN FALLS St/Beat: D1 District: RA:
Phone: Phone: GP: D101

Nature: FOLLOW UP Alarm Lvl: 1 Priority: 6 Medical Priority:

Reclassified Nature:

Caller: Alarm:
Addr: Alarm Type:

Vehicle #: St: OH Report Only: No Race: Sex: Age:

Call Taker: CAINJM Console: DISPCON710

Geo-Verified Addr.: Yes Nature Summary Code: Disposition: ACC Close Comments:

Notes:

Times

Call Received: 02/25/21 12:46:17	Time From Call Received	
Call Routed: 02/25/21 12:46:18	000:00:01	Unit Reaction: (1st Dispatch to 1st Arrive)
Call Take Finished: 02/25/21 12:46:18	000:00:01	En-Route: (1st Dispatch to 1st En-Route)
1st Dispatch:	(Time Held)	On-Scene: (1st Arrive to Last Clear)
1st En-Route:		
1st Arrive:		(Reaction Time)
Last Clear:		

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TR	Time Received	02/25/21 12:46:17	By: SELF		CAINJM
		FIN	Finished Call Taking	02/25/21 12:46:18			CAINJM
		VEVT	Viewed Event	02/25/21 12:46:23	User First Viewed Event CAD		WATSSJ
		VPRM	Viewed Premise	02/25/21 12:46:53	Location Information		CAINJM
		VPRM	Viewed Premise	02/25/21 12:46:55	Location Information		WATSSJ
		CAN	Event Cancelled	02/25/21 12:47:07		ACC	CAINJM

COMMUNICATIONS

Event Report

Event ID: 0210-550-439

Call Ref #: 413

Date/Time Received: 02/24/21 16:31:14

Rpt #:

Prime 183

Call Source: SELF

Unit: KEIFFER, KEVIN

Services Involved

LAW

Location: 5281 LOCUST HILL LN

X-ST: DUBLIN RD

Jur: CAD Service: LAW Agency: DPD

Sr/Beat: D1 District: RA:

Business: LODGE AT HAYDEN FALLS Phone: GP: D101

Nature: FOLLOW UP

Alarm Lvl: 1 Priority: 6 Medical Priority:

Reclassified Nature:

Caller:
Addr:

Phone: Alarm:
Alarm Type:

Vehicle #:

St: OH Report Only: No Race: Sex: Age:

Call Taker: FLESAM

Console: DISPCON210

Geo-Verified Addr.: Yes Nature Summary Code:

Disposition: M Close Comments:

Notes:

Times

Call Received: 02/24/21 16:31:14 Time From Call Received

Call Routed: 02/24/21 16:31:14

Call Take Finished: 02/24/21 16:31:14

1st Dispatch: 02/24/21 16:31:14

1st En-Route: 02/24/21 16:31:14

1st Arrive: 02/24/21 16:31:14

Last Clear: 02/24/21 16:31:58

Unit Reaction: (1st Dispatch to 1st Arrive)

En-Route: (1st Dispatch to 1st En-Route)

On-Scene: 000:00:44 (1st Arrive to Last Clear)

(Time Held)

(Reaction Time)

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
183	1149	D	Dispatched	02/24/21 16:31:14			FLESAM
183	1149	E	En-Route	02/24/21 16:31:14			FLESAM
183	1149	A	Arrived	02/24/21 16:31:14			FLESAM
152	2340	A	Arrived	02/24/21 16:31:19			FLESAM
152	2340	DXY	DispatchXY	02/24/21 16:31:19	1797653.88,765316.75		FLESAM
152	2340	D	Dispatched	02/24/21 16:31:19			FLESAM
152	2340	E	En-Route	02/24/21 16:31:19			FLESAM
183	1149	C	Cleared	02/24/21 16:31:58 M		M	FLESAM
152	2340	C	Cleared	02/24/21 16:31:58 M		M	FLESAM

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TR	Time Received	02/24/21 16:31:14	By: SELF		FLESAM
		FIN	Finished Call Taking	02/24/21 16:31:14			FLESAM
		VCCHS	Viewed Call History	02/24/21 16:31:24	Location Information		FLESAM

Employee Info

Unit	Empl ID	Name
152	2340	WILLIAMS, JACOB G
183	1149	KEIFFER, KEVIN

COMMUNICATIONS

Event Report

Event ID: 0210-820-177 Call Ref #: 650 Date/Time Received: 03/23/21 08:59:38

Rpt #: _____ Prime Unit: _____
Call Source: SELF Services Involved:

LAW					
-----	--	--	--	--	--

Location: 5281 LOCUST HILL LN
X-ST: DUBLIN RD Jur: CAD Service: LAW Agency: DPD
Business: LODGE AT HAYDEN FALLS St/Beat: D1 District: RA:
Phone: GP: D101

Nature: FOLLOW UP Alarm Lvl: 1 Priority: 6 Medical Priority:

Reclassified Nature:

Caller: _____ Alarm:
Addr: _____ Alarm Type:

Vehicle #: _____ St: OH Report Only: No Race: _____ Sex: _____ Age: _____

Call Taker: HAYEAL Console: DISPCON610

Geo-Verified Addr.: Yes Nature Summary Code: _____ Disposition: ACC Close Comments:

Notes:

Times	
Call Received: 03/23/21 08:59:38	Time From Call Received
Call Routed: 03/23/21 08:59:38	Unit Reaction: (1st Dispatch to 1st Arrive)
Call Take Finished: 03/23/21 08:59:38	En-Route: (1st Dispatch to 1st En-Route)
1st Dispatch:	On-Scene: (1st Arrive to Last Clear)
1st En-Route:	(Time Held)
1st Arrive:	(Reaction Time)
Last Clear:	

Event ID: 0210-820-177

Call Ref #: 650

FOLLOW UP at 5281 LOCUST HILL LN

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TR	Time Received	03/23/21 08:59:38	By: SELF		HAYEAL
		FIN	Finished Call Taking	03/23/21 08:59:38			HAYEAL
		VEVT	Viewed Event	03/23/21 08:59:41	User First Viewed Event CAD		GOLDBA
		CAN	Event Cancelled	03/23/21 08:59:47		ACC	HAYEAL

COMMUNICATIONS

Event Report

Event ID: 0211-260-322 Call Ref #: 956 Date/Time Received: 05/06/21 13:40:14

Rpt #: Prime 157

Call Source: PHONE Unit: BROWN, SCOTT A

LAW

Location: 5281 LOCUST HILL LN

X-ST: DUBLIN RD Jur: CAD Service: LAW Agency: DPD

St/Beat: D1 District: RA:

Business: LODGE AT HAYDEN FALLS Phone: GP: D101

Nature: 13-MISCELLANEOUS CALL Alarm Lvl: 1 Priority: 5 Medical Priority:

Reclassified Nature:

Caller: PREV. OFFICER HAMILTON

Phone: Alarm: Alarm Type:

Vehicle #: St: Report Only: No Race: Sex: Age:

Call Taker: SEYMCC Console: DISPCON4

Geo-Verified Addr.: Yes Nature Summary Code: PASS Disposition: M Close Comments:

Notes: drone needed [05/06/21 13:40:29 SEYMCC]

Times

Time From	Call Received	Unit Reaction
Call Received: 05/06/21 13:40:14	000:00:17	000:31:48 (1st Dispatch to 1st Arrive)
Call Routed: 05/06/21 13:40:31	000:00:17	En-Route: 000:00:03 (1st Dispatch to 1st En-Route)
Call Take Finished: 05/06/21 13:40:31	000:00:26 (Time Held)	On-Scene: 001:12:42 (1st Arrive to Last Clear)
1st Dispatch: 05/06/21 13:40:40	000:00:29	
1st En-Route: 05/06/21 13:40:43	000:32:14 (Reaction Time)	
1st Arrive: 05/06/21 14:12:28	001:44:56	
Last Clear: 05/06/21 15:25:10		

Event ID: 0211-260-322 Call Ref #: 956 13-MISCELLANEOUS CALL at 5281 LOCUST HILL LN

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
157	235	DXY	DispatchXY	05/06/21 13:40:40	1802707.87,776923.23		STRODJ
157	235	D	Dispatched	05/06/21 13:40:40	Stat/Beat: DCIT		STRODJ
157	235	E	En-Route	05/06/21 13:40:43	Auto-enrouting with offset of 1 seconds.		BROWSA
157	235	A	Arrived	05/06/21 14:12:28			Unit: 157
157	235	AAT	Auto Arrive Timestamp	05/06/21 14:12:29	Current status is:A. Offset of 0 seconds.		BROWSA
157	235	C	Cleared	05/06/21 15:25:10		M	FLESAM

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TR	Time Received	05/06/21 13:40:14	By: PHONE		SEYMCC
		DLS	Duplicate List	05/06/21 13:40:17	Potential Duplicate Events Listed (1		SEYMCC
		ENT	Entered Street	05/06/21 13:40:21	5281 LOCUST HILL LN		SEYMCC
		ENT	Entered Nature	05/06/21 13:40:23	13-MISCELLANEOUS CALL		SEYMCC
		ENT	Entered Remarks	05/06/21 13:40:29			SEYMCC
		FIN	Finished Call Taking	05/06/21 13:40:31			SEYMCC
		VEVT	Viewed Event	05/06/21 13:40:33	User First Viewed Event CAD		STRODJ
		VEVT	Viewed Event	05/06/21 13:40:35	User First Viewed Event CAD		STRODJ
		ENT	Entered CallerName Ca	05/06/21 13:40:54	PREV. OFFICER HAMILTON		CAINJM
		VCHS	Viewed Call History	05/06/21 13:42:23	Location Information		SEYMCC
		VCHS	Viewed Call History	05/06/21 13:42:24	Location Information		STRODJ
		VEVT	Viewed Event	05/06/21 13:43:08	User First Viewed Event CAD		WATSSJ
		VPRM	Viewed Premise	05/06/21 13:43:16	Location Information		WATSSJ
		VCHS	Viewed Call History	05/06/21 13:43:23	Location Information		WATSSJ
		VCHS	Viewed Call History	05/06/21 13:43:26	Location Information		WATSSJ
		RSW	Reset Watchdog Timer	05/06/21 14:30:41	Units: 157 >>> 999Min.		WATSSJ
		VEVT	Viewed Event	05/06/21 14:59:03	User First Viewed Event CAD		CAINJM
		VEVT	Viewed Event	05/06/21 15:06:48	User First Viewed Event CAD		MUETJA
							FLESAM

Related Names

Last, First, MI Suffix	Type	Race	Sex	HT	WT	Eyes	DOB	Age	Home / Mobile Ph	Work Ph
Prev., Officer Hamilton	CALL							0		

Address:

Oln:

Notes:

Oln St:

Event Report

Event ID: 0211-260-322 Call Ref #: 956 13-MISCELLANEOUS CALL at 5281 LOCUST HILL LN

		Employee Info
Unit	Empl ID	Name
157	235	BROWN, SCOTT A

COMMUNICATIONS

Event Report

Event ID: 0211-310-253

Call Ref #: 707

Date/Time Received: 05/11/21 11:48:11

Rpt #:

Prime 156

Call Source: PHONE

Unit: WILLIAMS, MATTHEW M

Services Involved

LAW

Location: 5281 LOCUST HILL LN

X-ST:

DUBLIN RD

Jur: CAD Service: LAW Agency: DPD

Sv/Beat: D1 District: RA:

Business: LODGE AT HAYDEN FALLS

Phone:

GP: D101

Nature: 13-MISCELLANEOUS CALL

Alarm Lvl: 1 Priority: 5

Medical Priority:

Reclassified Nature:

Caller: FAUL, KENNY

Addr:

Phone:

Alarm:

Alarm Type:

Vehicle #:

St:

Report Only: No

Race:

Sex:

Age:

Call Taker: HAYEAL

Console: DISPCON3

Geo-Verified Addr.: Yes

Nature Summary Code: PASS

Disposition: M

Close Comments:

Notes: 1A1 AND 1L1 SPOKE TO SUBJ HE HAS SINCE LEFT DPD [05/11/21 12:26:33 GOLDBA]

UDTS: SUPV NOTIFIED RUN HOLDING [05/11/21 12:00:16 GOLDBA]

IN LOBBY AT 25 [05/11/21 11:50:32 HAYEAL]

in lobby wanting to file a report about tools lost in a house fire in february, he said records told him he should come in and file a report. wants to speak with officer. [05/11/21 11:50:19 HAYEAL]

Times

Time From Call Received

Call Received: 05/11/21 11:48:11
 Call Routed: 05/11/21 11:50:19
 Call Take Finished: 05/11/21 11:50:19
 1st Dispatch: 05/11/21 12:12:20
 1st En-Route: 05/11/21 12:15:46
 1st Arrive: 05/11/21 12:15:46
 Last Clear: 05/11/21 12:26:35

Unit Reaction: 000:03:26 (1st Dispatch to 1st Arrive)
 En-Route: 000:03:26 (1st Dispatch to 1st En-Route)
 On-Scene: 000:10:49 (1st Arrive to Last Clear)

000:02:08
 000:02:08
 000:24:09 (Time Held)
 000:27:35
 000:27:35 (Reaction Time)
 000:38:24

Radio Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
156	3067	DXY	DispatchXY	05/11/21 12:12:20	1788751.58,766323.70		GOLDBA
156	3067	D	Dispatched	05/11/21 12:12:20	Stat/Beat: D2		GOLDBA
156	3067	L	Location Change	05/11/21 12:12:37	DPD HQ 6565 COMMERCE PKWY		GOLDBA
156	3067	A	Arrived	05/11/21 12:15:46			Unit:156
156	3067	C	Cleared	05/11/21 12:26:35		M	GOLDBA

Event Log

Unit	Empl ID	Type	Description	Time Stamp	Comments	Close Code	User
		TR	Time Received	05/11/21 11:48:11	By: PHONE		HAYEAL
		ENT	Entered Street	05/11/21 11:48:24	5281 LOCUST HILL LN		HAYEAL
		ENT	Entered CallerName Ca	05/11/21 11:48:42	FAUL KENNY		HAYEAL
		ENT	Entered CallerPhone	05/11/21 11:48:52	[REDACTED]		HAYEAL
		ENT	Entered Nature	05/11/21 11:48:56	13-MISCELLANEOUS CALL		HAYEAL
		ENT	Entered Remarks	05/11/21 11:50:19			HAYEAL
		FIN	Finished Call Taking	05/11/21 11:50:19			HAYEAL
		ARM	Added Remarks	05/11/21 11:50:32			HAYEAL
		VEVT	Viewed Event	05/11/21 11:50:40	User First Viewed Event CAD		GOLDBA
		VEVT	Viewed Event	05/11/21 11:51:09	User First Viewed Event CAD		SEYMCC
		VPRM	Viewed Premise	05/11/21 11:51:25	Location information		SEYMCC
		VPRM	Viewed Premise	05/11/21 11:58:43	Location information		GOLDBA
		VCHS	Viewed Call History	05/11/21 11:58:49	Location information		GOLDBA
		VCHS	Viewed Call History	05/11/21 11:58:50	Location information		GOLDBA
		SNH	SUPV NOTIFIED RUN	05/11/21 12:00:16			GOLDBA
		ARM	Added Remarks	05/11/21 12:00:16			GOLDBA
		VEVT	Viewed Event	05/11/21 12:07:57	User First Viewed Event CAD		GOLDBA
		VEVT	Viewed Event	05/11/21 12:16:31	User First Viewed Event CAD		KARNBP
							HUMMJA

Event ID: 0211-310-253 Call Ref #: 707 13-MISCELLANEOUS CALL at 5281 LOCUST HILL LN

ARM Added Remarks 05/11/21 12:26:33 GOLDBA

Related Names

Last, First, MI Suffix	Type	Race	Sex	HT	WT	Eyes	DOB	Age	Home / Mobile Ph	Work Ph
Faul, Kenny	CALL				0				[REDACTED]	

Address:

OIn:

Notes:

OIn St:

Employee Info

Unit	Empl ID	Name
156	3067	WILLIAMS, MATTHEW M

Insured: Ottercreek Group LLC
EFI Global File #: 019.02004

ATTACHMENT 6

WEATHER REPORT

Search Locations

My Profile



Recent Cities

Dublin, OH (43017) (/weather/us/oh/dublin/40.10,-83.13) Boon Township, MI (49618) (/weather/us/mi/boon-township/44.32,-85.57)

40 °N, 82.89 °W

Columbus, OH Weather History ★ 🏠

☀️ 77° JOHN GLENN COLUMBUS INTERNATIONAL AIRPORT STATION

(/DASHBOARD/PWS/KOHCOLUM352?CM_VEN=LOCALWX_PWSDASH) | CHANGE ✓

HISTORY (/HISTORY/DAILY/US/OH/COLUMBUS/KCMH)

- [TODAY \(/WEATHER/US/OH/COLUMBUS/KCMH\)](#)
- [HOURLY \(/HOURLY/US/OH/COLUMBUS/KCMH\)](#)
- [10-DAY \(/FORECAST/US/OH/COLUMBUS/KCMH\)](#)
- [CALENDAR \(/CALENDAR/US/OH/COLUMBUS/KCMH\)](#)
- [HISTORY \(/HISTORY/DAILY/US/OH/COLUMBUS/KCMH\)](#)
- [WUNDERMAP \(/WUNDERMAP?LAT=39.998&LON=-82.889\)](#)

Daily

Weekly

Monthly

(/history/daily/us/oh/columbus/kcmh/date/2021-02-09) (/history/daily/us/oh/columbus/kcmh/date/2021-02-09) (/history/daily/us/oh/columbus/kcmh/date/2021-02-09)

2-9)

2-9)

2)



February


9

2021

View

12AM 3AM 6AM 9AM 12PM 3PM 6PM 9P

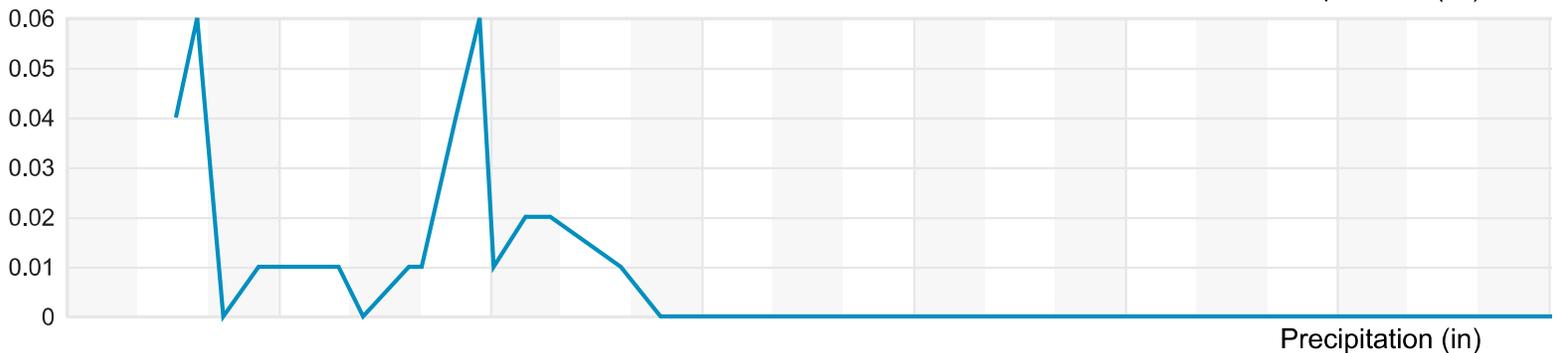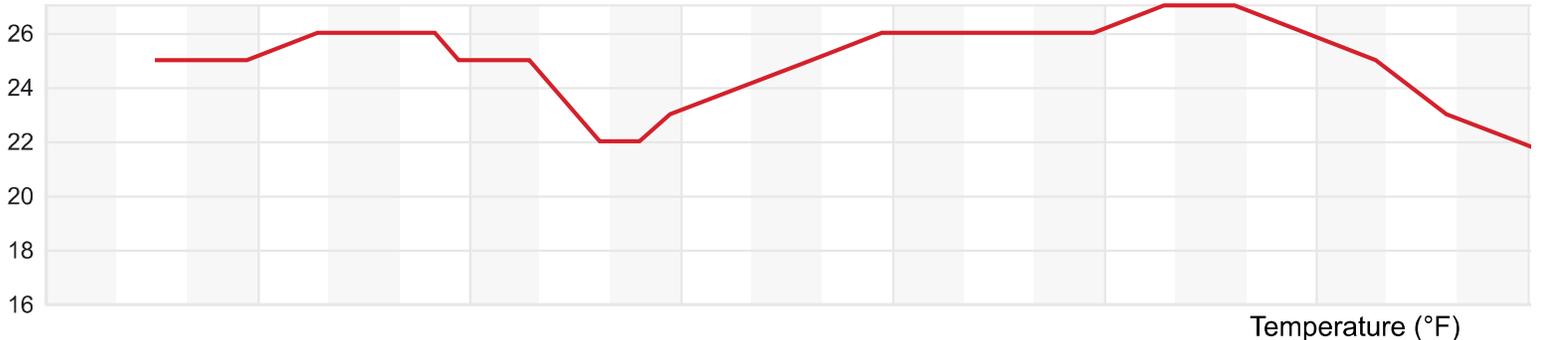

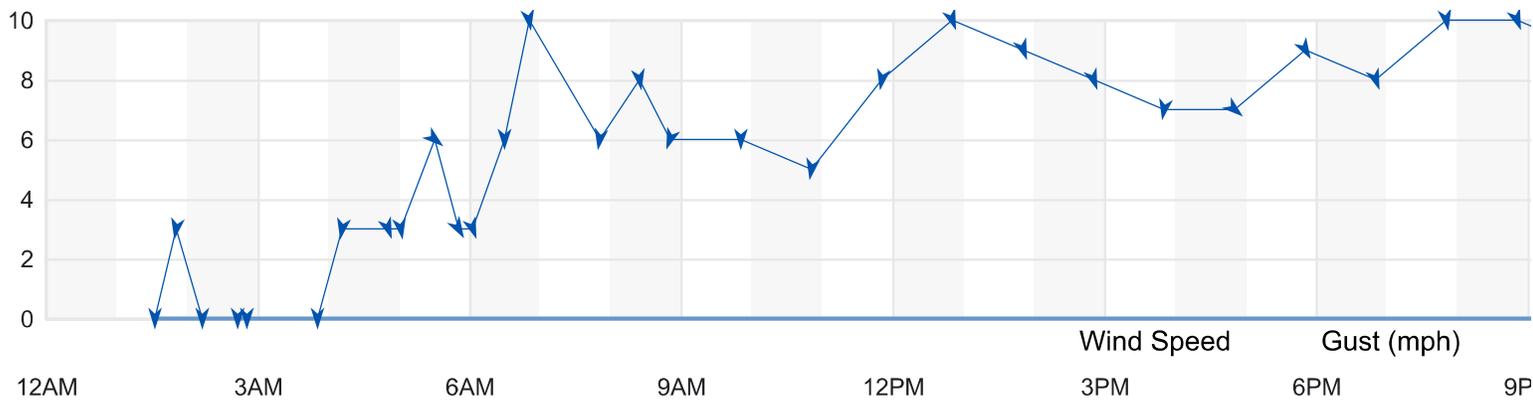

Summary

Temperature (° F)	Actual	Historic Avg.	Record	▲
High Temp	27	39.2	66	
Low Temp	16	22.9	-17	
Day Average Temp	24.18	31	-	
Precipitation (Inches)	Actual	Historic Avg.	Record	▲
Precipitation (past 24 hours from 11:51:00)	0.21	5.50	-	
Dew Point (° F)	Actual	Historic Avg.	Record	▲
Dew Point	20.39	-	-	
High	24	-	-	
Low	11	-	-	
Average	20.39	-	-	
Wind (MPH)	Actual	Historic Avg.	Record	▲
Max Wind Speed	10	-	-	
Visibility	9	-	-	
Sea Level Pressure (Hg)	Actual	Historic Avg.	Record	▲
Sea Level Pressure	29.45	-	-	
Astronomy	Day Length	Rise	Set	▲
Actual Time	10h 28m	7:32 AM	6:01 PM	

Temperature (° F)	Actual	Historic Avg.	Record	▲
Civil Twilight		7:04 AM	6:29 PM	
Nautical Twilight		6:32 AM	7:01 PM	
Astronomical Twilight		6:01 AM	7:33 PM	
Moon: waning crescent		6:20 AM	3:44 PM	

Daily Observations

Time	Temperature	Dew Point	Humidity	Wind	Wind Speed	Wind Gust	Pressure	Precip
1:33 AM	25 °F	24 °F	96 %	CALM	0 mph	0 mph	29.31 in	0.0 i
1:51 AM	25 °F	24 °F	96 %	N	3 mph	0 mph	29.30 in	0.1 i
2:13 AM	25 °F	24 °F	96 %	CALM	0 mph	0 mph	29.30 in	0.0 i
2:43 AM	25 °F	23 °F	92 %	CALM	0 mph	0 mph	29.30 in	0.0 i
2:51 AM	25 °F	23 °F	92 %	CALM	0 mph	0 mph	29.29 in	0.0 i
3:51 AM	26 °F	24 °F	92 %	CALM	0 mph	0 mph	29.29 in	0.0 i
4:12 AM	26 °F	24 °F	92 %	N	3 mph	0 mph	29.29 in	0.0 i
4:51 AM	26 °F	24 °F	92 %	NNW	3 mph	0 mph	29.29 in	0.0 i
5:02 AM	26 °F	24 °F	92 %	N	3 mph	0 mph	29.29 in	0.0 i
5:31 AM	26 °F	24 °F	92 %	NW	6 mph	0 mph	29.30 in	0.0 i
5:51 AM	25 °F	24 °F	96 %	NNW	3 mph	0 mph	29.30 in	0.1 i
6:03 AM	25 °F	24 °F	96 %	NNW	3 mph	0 mph	29.30 in	0.0 i
6:30 AM	25 °F	24 °F	96 %	N	6 mph	0 mph	29.30 in	0.0 i
6:51 AM	25 °F	23 °F	92 %	N	10 mph	0 mph	29.30 in	0.0 i
7:51 AM	22 °F	19 °F	89 %	N	6 mph	0 mph	29.30 in	0.0 i
8:25 AM	22 °F	19 °F	89 %	N	8 mph	0 mph	29.32 in	0.0 i
8:51 AM	23 °F	20 °F	88 %	NNE	6 mph	0 mph	29.32 in	0.0 i
9:51 AM	24 °F	19 °F	81 %	N	6 mph	0 mph	29.34 in	0.0 i
10:51 AM	25 °F	20 °F	81 %	N	5 mph	0 mph	29.35 in	0.0 i
11:51 AM	26 °F	20 °F	78 %	N	8 mph	0 mph	29.34 in	0.0 i
12:51 PM	26 °F	20 °F	78 %	NNW	10 mph	0 mph	29.36 in	0.0 i
1:51 PM	26 °F	21 °F	81 %	NNW	9 mph	0 mph	29.35 in	0.0 i

Time	Temperature	Dew Point	Humidity	Wind	Wind Speed	Wind Gust	Pressure	Prec
2:51 PM	26 °F	21 °F	81 %	NNW	8 mph	0 mph	29.34 in	0.0 i
3:51 PM	27 °F	20 °F	75 %	N	7 mph	0 mph	29.34 in	0.0 i
4:51 PM	27 °F	19 °F	72 %	NW	7 mph	0 mph	29.35 in	0.0 i
5:51 PM	26 °F	19 °F	75 %	NNW	9 mph	0 mph	29.38 in	0.0 i
6:51 PM	25 °F	18 °F	75 %	NNW	8 mph	0 mph	29.40 in	0.0 i
7:51 PM	23 °F	16 °F	74 %	N	10 mph	0 mph	29.41 in	0.0 i
8:51 PM	22 °F	16 °F	78 %	NNW	10 mph	0 mph	29.43 in	0.0 i
9:51 PM	21 °F	16 °F	81 %	NNW	9 mph	0 mph	29.44 in	0.0 i
10:51 PM	19 °F	14 °F	81 %	N	8 mph	0 mph	29.44 in	0.0 i
11:51 PM	17 °F	12 °F	81 %	N	6 mph	0 mph	29.44 in	0.0 i
12:51 AM	16 °F	11 °F	81 %	N	7 mph	0 mph	29.45 in	0.0 i

ATTACHMENT 7

Insurance Carrier Information

Sworn Statement in Proof of Loss: Actual Cash Value and Replacement Cost Event #:

This form must be signed and notarized at the bottom of the page. Complete all sections.

Policy Number	BMO589884293	Claim Number	23894159	
Policy Amount	BLDG Mat. Lim. \$895,572, Existing BLDG Lim. \$900,000		Effective Dates	7/12/2020 to 7/12/2021 <small>(mm/dd/yyyy)</small>

The Ohio Casualty Ins Co _____ by the above numbered policy insured OTTERCREEK GROUP LLC
(Underwriting Company) (Policy Holder)

under said policy, and according to the terms and conditions, all forms and endorsements attached thereto.

TIME AND ORIGIN: A fire (state kind) occurred about the hour of 12:15 AM on the 10th day of February 2021 at 5821 Locust Hill Lane, Dublin, OH 43017

The cause and origin of the loss was: intentionally set fire by an unknown person at this time

OCCUPANCY: The building described, or containing the property described, was occupied at the time of the loss as follows, and for no other purpose whatever: _____

TITLE AND INTEREST: At the time of loss the interest of the insured in the property described was _____ and no other person(s) had any interest therein or encumbrance thereon except: _____

CHANGES: Since the said policy was acquired there has been no assignment thereof, or change of ownership or interest, use, occupancy, possession, location or exposure of the property, except: _____

- 1. **Replacement Cost of Property:** at the time of loss \$ _____
- 2. **Replacement or Repair Cost:** at the time of the loss was \$ 900,254.23
- 3. **Applicable Depreciation or Betterment:** \$ 83,057.88
- 4. **Actual Cash Value Loss:** (line 2 minus line 3) \$ 817,196.35
- 5. **Deductible:** \$ 1,000.00
- 6. **ACTUAL CASH VALUE CLAIM:** (line 4 minus line 5) \$ 816,196.35

7. **Replacement Cost Claim, Eligibility Requirement:** The insured must first comply with the terms and conditions of the replacement cost provisions of the policy. If the insured elects to file a replacement cost claim, said supplemental claim must be filed within a reasonable time, but no later than Existing Building is insured at actual cash value.

The amount should not exceed The depreciation is non-recoverable as the existing building is insured at actual cash value.

STATEMENT OF INSURED: The insured under the above numbered policy, hereby claims and agrees to accept from the insurer, in Full satisfaction and indemnity for the replacement cost of all claims of loss or damage, the sum of \$816,196.35

(\$377,994.82 Existing Building Actual Cash Value Measure less ded. plus \$438,201.53 for the existing building materials damage)

Nothing has been done by or with the insured's knowledge or consent to violate the conditions of the policy or render it void; no articles are mentioned herein or in annexed schedules, but such as were damaged or destroyed at the time of the loss; no property saved has been in any manner concealed, and no attempt to deceive the said company as to the extent of said loss has in any manner been made, and no material fact is withheld of which the company should be informed

Any other information that may be required will be furnished and be considered part of this proof. It is expressly understood that the furnishing of this blank form to the insured, or any investigation undertaken, or the preparing of proof of loss by a company representative, is not a waiver of any of its rights.

Loss State

OH

Any person who, with intent to defraud or knowing that he is facilitating a fraud against an insurer, submits an application or files a claim containing a false or deceptive statement is guilty of insurance fraud.

State of _____ Insured _____
Print name and company

County of _____ Signature & title _____

Subscribed and sworn to me this _____ day of _____ 20 _____

NOTARY PUBLIC OR JUSTICE OF THE PEACE

Forwarded message

From: **O'Sullivan, Cornelius J.** <cosullivan@westonhurd.com>
Date: Mon, May 17, 2021 at 8:08 AM
Subject: Status Update 5-17-21 Claim No. E2F96497-Hanlin Rainaldi Construction Corp.-
To: sean.suttle@hanlinrainaldi.com <sean.suttle@hanlinrainaldi.com>, Hettenbach, Donald A. <Donald.Hettenbach@cna.com>
Cc: Riccobene, Stephanie M. <SRiccobene@westonhurd.com>

Our C&O team at SEA, Ltd. has come to a point in their analysis that leads them to the conclusion that this was an act of Arson. All of the experts and representatives of the CFD were on site to examine evidence and discuss findings. There is no evidence that this fire started due to any negligent action or inaction on the part of Hanlin Rainaldi or any of their subcontractors. There is evidence that a window in the great room was broken from the outside, and that a gas can was used to spread accelerant throughout that room. The evidence is so strong that our team, along with the other insurance investigators, believes there is nothing more for them to do. They will preserve any evidence that has been collected but will close their files. I will do the same. It is now up to the CFD to identify, if possible, the perpetrators. Thank you for your assistance and cooperation through tout this investigation. Please feel free to contact me with any questions or concerns that may arise.

Cornelius O'Sullivan

Attorney at Law



1300 East 9th Street, Suite 1400
Cleveland, OH 44114
p: 216-687-3270 | f: 216-621-8369
[Website](#) | [Offices](#)



Please Note Our New Cleveland Office Address as of November 1, 2020

Confidentiality Notice:

This message is a private communication and may contain privileged or confidential information and may not be used or relied upon by anyone other than the intended recipient.